

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: FIRST_RUN_CT	Cross Street: MONARCH_BIRCH_LN	Location: E
ADA ID: 62612FBF383D	Ramp Type: Combination2Diag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 0	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

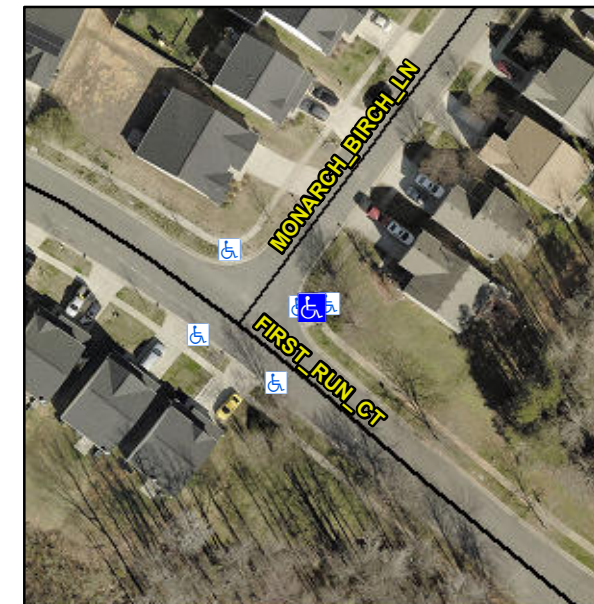

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.1, R304.5.1, R304.5.3, R304.3.2**

Total Cost:

**\$ 3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	55.5	N/A	Ramp Length RT (in)	53.0
No	Ramp Width LT (in)	47.0	No	Ramp Width RT (in)	47.0
No	Ramp Slope LT (%)	9.0	Yes	Ramp Slope RT (%)	1.4
No	Ramp XSlope LT (%)	5.8	No	Ramp XSlope RT (%)	5.0
N/A	Ramp Length (in)	86.5	Yes	Ramp Slope (%)	7.0
No	Ramp Width (in)	46.5	No	Ramp XSlope (%)	4.7
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	0.1
	X Walk 1 X Slope (%)	3.6		X Walk 2 X Slope (%)	0.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.8		Clear Space?	N/A
	Road X Slope (%)	1.0	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	12.5

Street 1 Name	StopSign
Stop Condition-Street 1	MONARCH BIRCH LN
Street 2 Name	None
Stop Condition-Street 2	FIRST RUN CT

