


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 48421 Main Street: EVANTON LOCH RD **Cross Street: CULLEN CT** Location: SW **Overall Compliance: No** ADA ID: 64A9C6DF087C Ramp Type: PerpDiag Initial Pass/Fail: Fail **Severity Score:** 12.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

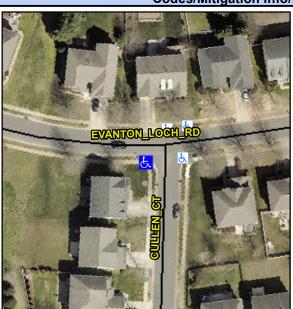

CULLEN CT Street 1 Name StopSign Stop Condition-Street 2 Street 2 Name **EVANTON LOCH RD** Stop Condition-Street 1 None

Possible Solution
Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.
Surveyor Notes:
N/A
PROW/ADA:
R304.2.2

Surveyor Notes.		IN/
N/A		N/
		N/
		N/
		N/
PROW/ADA:		N/
R304.2.2		N/
		N/
Total Cost:	\$ 3200.00	

Comp	liance Description	Data	Comp	Data	
N/A	Ramp Length (in)	47.0	No	Ramp Slope (%)	8.8
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.4
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	4.2
	X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	0.1
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.7	N/A	Clear Space?	N/A
	Road X Slope (%)	1.0	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good





