

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14023	Main Street: NORWICH_PL	Cross Street: CHELVESTON_DR	Location: SW
ADA ID: 65B17575F056	Ramp Type: Combination2Diag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

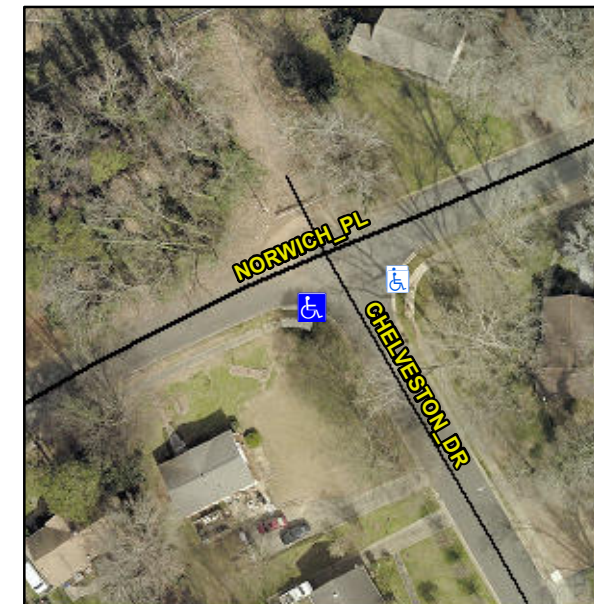

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

DWS WARPED

PROW/ADA:

Not Found, R304.5.3, R305.1.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	N/A	N/A	Ramp Length RT (in)	118.0
N/A	Ramp Width LT (in)	N/A	Yes	Ramp Width RT (in)	59.0
N/A	Ramp Slope LT (%)	N/A	Yes	Ramp Slope RT (%)	7.4
N/A	Ramp XSlope LT (%)	N/A	No	Ramp XSlope RT (%)	4.4
N/A	Ramp Length (in)	59.0	Yes	Ramp Slope (%)	6.6
Yes	Ramp Width (in)	58.0	Yes	Ramp XSlope (%)	1.9
Yes	Flare Type L	Curbed_NoWalkSurface	Yes	Flare Type R	Curbed_NoWalkSurface
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	59.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	69.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.2	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.4	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	Yes			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.7
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.2		X Walk 2 Slope (%)	3.2
	X Walk 1 X Slope (%)	4.6		X Walk 2 X Slope (%)	0.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.9		Clear Space?	Yes
	Road X Slope (%)	6.8	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstruction?	No
				Obstruction Type	N/A
			Yes	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	7.9

