

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: N/A Main Street: INVERNESS_BAY_RD Cross Street: OBAN_PASSAGE_DR Location: SE

ADA ID: 6863671FAB99 Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

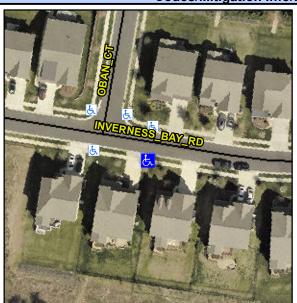

	THE RESERVE OF THE PARTY OF THE
Street 1 Name	INVERNESS BAY RD
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Possible Solutions:	С
Remove & Replace Entire Ramp.	N
•	Ye
	N/
	N
	N
	N
Surveyor Notes:	N
N/A	N
	N
	N
	N
PROW/ADA:	N
Not Found, R304.2.2	N/
·	N
	N

Total Cost:



1850.00

Comr	oliance Description	Data			Description	Data
N/A	Ramp Length (in)	44.5	No		Slope (%)	11.9
Yes	Ramp Width (in)	48.0	Yes		XSlope (%)	3.7
N/A	Flare Type LT	N/A	N/A		Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A		Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A		Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A		Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A
N/A	Shared Landing?	N/A			()	
N/A	Gutter Ponding?	N/A	N/A	Gutte	er Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A		er X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A		ed X Walk2?	N/A
	X Walk 1 Direction	To NE			lk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Wa	ılk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.0			ılk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.3			ılk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A		o inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A		· Space?	N/A
	Road X Slope (%)	N/A	N/A		Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A		n Grate/Utility Hazard?	N/A
	Obstruction Type				n Grate/Utility Type	
		N/A		2.5111	, .,,,	N/A
			Yes	Surfa	ce Condition? (G/P)	Good
			,	Odila	oo conducti: (On)	Coou

