

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11799	Main Street: MECKLENBURG_AV	Cross Street: NORCROSS_PL	Location:	S
ADA ID: 68870FCFFAE8	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

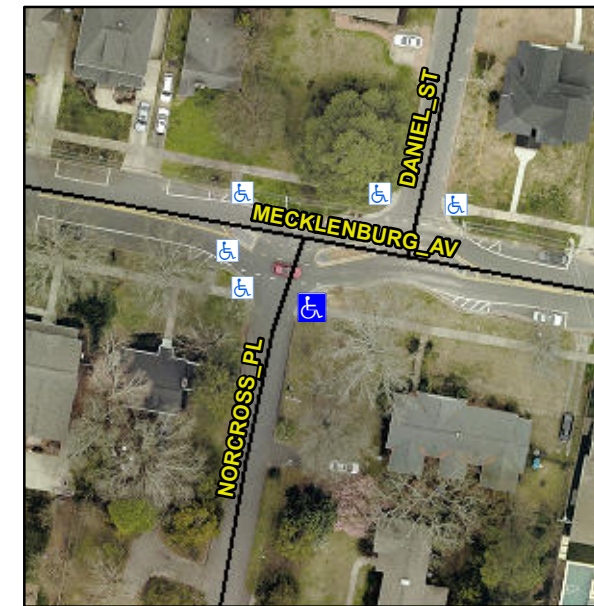

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305.2, R302.7, R304.5.4

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	168.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	62.0	No	Grade Break Slope (%)	5.5
Yes	Ramp Slope (%)	7.2	Yes	Grade Break XSlope (%)	0.1
Yes	Ramp XSlope (%)	0.8			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	54.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	59.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.1	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	4.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	31.0
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	8.3
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.9
N/A	Painted X Walk1?	No		Road Slope (%)	3.3
	X Walk 1 Direction	To W		Road X Slope (%)	3.5
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	3.3	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	3.5	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	7.8

Total Cost: \$ 2350.00

