


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|   |                        |   |                        |
|---|------------------------|---|------------------------|
| Intersection ID: 7195                   | Main Street: REAGAN_DR | Cross Street: TOM_HUNTER_RD             | Location: SE           |
| ADA ID: 6A0E0DD3EC38                    | Ramp Type: Para        | Initial Pass/Fail: Fail                 | Overall Compliance: No |
| Codes/Mitigation Info/Possible Solution |                        | Field Measurements/Component Compliance |                        |
| Severity Score: 26.25                   |                        |   |                        |

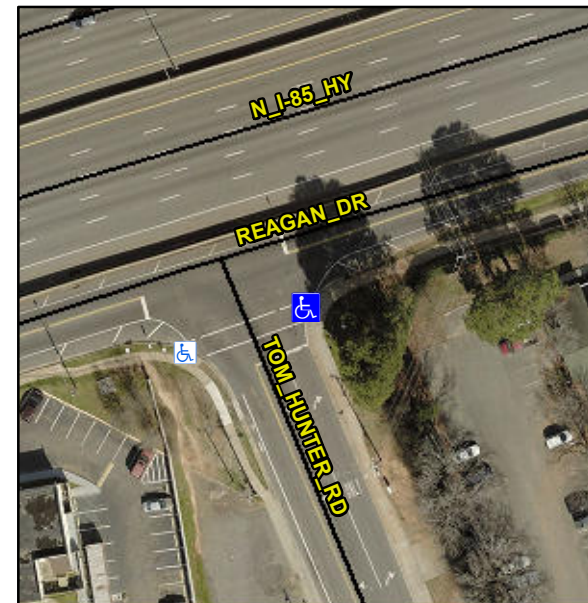

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.3.2, R304.5.3**

Total Cost: \$ 1600.00

| Compliance | Description          | Data  | Compliance | Description                 | Data |
|------------|----------------------|-------|------------|-----------------------------|------|
| N/A        | Ramp Length LT (in)  | 45.0  | N/A        | Ramp Length RT (in)         | 46.0 |
| Yes        | Ramp Width LT (in)   | 83.0  | Yes        | Ramp Width RT (in)          | 83.0 |
| Yes        | Ramp Slope LT (%)    | 5.4   | No         | Ramp Slope RT (%)           | 18.2 |
| Yes        | Ramp XSlope LT (%)   | 1.4   | No         | Ramp XSlope RT (%)          | 3.8  |
| N/A        | Landing Length (in)  | N/A   | N/A        | DWS Provided?               | N/A  |
| N/A        | Landing Width (in)   | N/A   | N/A        | DWS Contrast?               | N/A  |
| N/A        | Landing Slope (%)    | N/A   | N/A        | DWS Length (in)             | N/A  |
| N/A        | Landing X Slope (%)  | N/A   | N/A        | DWS Full Width?             | N/A  |
| N/A        | Landing Curb? (Y/N)  | N/A   | N/A        | DWS Offset (in)             | N/A  |
| N/A        | Shared Landing?      | N/A   |            |                             |      |
| N/A        | Gutter Ponding?      | N/A   | N/A        | Gutter Slope (%)            | N/A  |
| N/A        | Gutter Lip Ht (in)   | N/A   | N/A        | Gutter X Slope (%)          | N/A  |
| N/A        | Painted X Walk1?     | No    | N/A        | Painted X Walk2?            | N/A  |
|            | X Walk 1 Direction   | To SW |            | X Walk 2 Direction          | N/A  |
| N/A        | X Walk 1 Width (in)  | N/A   | N/A        | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)   | 1.6   |            | X Walk 2 Slope (%)          | N/A  |
|            | X Walk 1 X Slope (%) | 3.5   |            | X Walk 2 X Slope (%)        | N/A  |
| N/A        | Ramp inside XWalk1?  | N/A   | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)       | N/A   | N/A        | Clear Space?                | N/A  |
|            | Road X Slope (%)     | N/A   | N/A        | Clear Space to XWalk (in)   | N/A  |
| N/A        | Any Obstructions?    | N/A   | N/A        | Storm Grate/Utility Hazard? | N/A  |
|            | Obstruction Type     |       |            | Storm Grate/Utility Type    |      |
|            |                      | N/A   |            |                             | N/A  |
|            |                      |       | Yes        | Surface Condition? (G/P)    | Good |
|            |                      |       | N/A        | Curb Slope (%)              | 22.9 |

