

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 8208 Main Street: BROOKSHIRE_BV Cross Street: N_CRIGLER_ST Location: NW

ADA ID: 70FF8A2421AC Ramp Type: Para Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

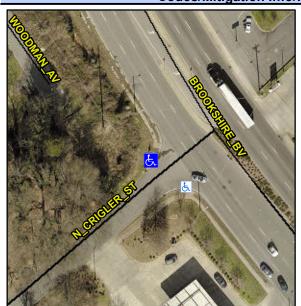

Street 1 Name

N CRIGLER ST
Stop Condition-Street 1
StopSign
Street 2 Name
N/A
Stop Condition-Street 2
N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

R304.5.3, R304.3.2

Total Cost: \$ 1600.00

Compliance Description		Data	Compliance Description		Data
N/A	Ramp Length LT (in)	62.0	N/A	Ramp Length RT (in)	59.0
Yes	Ramp Width LT (in)	72.0	Yes	Ramp Width RT (in)	72.0
Yes	Ramp Slope LT (%)	3.1	No	Ramp Slope RT (%)	9.6
No	Ramp XSlope LT (%)	3.8	Yes	Ramp XSlope RT (%)	1.2
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	30.7





