



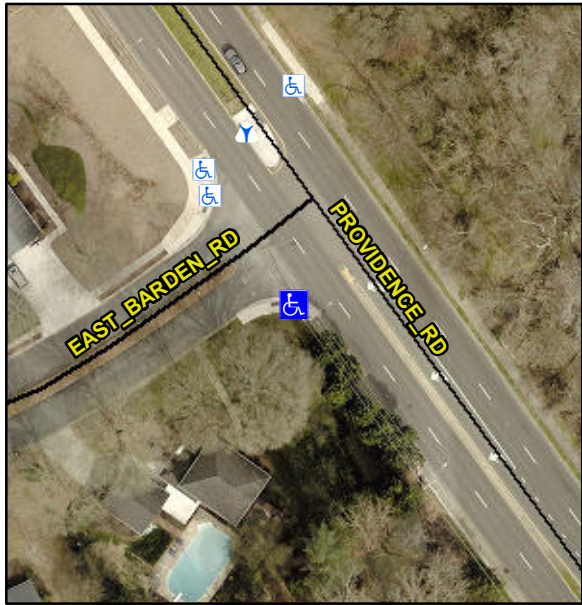
Access Compliance Report

Public Rights-of-Way

(Curb Ramps)



Intersection ID: 20718	Main Street: PROVIDENCE_RD	Cross Street: EAST_BARDEN_RD	Location: S
ADA ID: 754993630169	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 13.75	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length LT (in)	67.0
			Yes	Ramp Width LT (in)	59.0
			Yes	Ramp Slope LT (%)	3.4
			No	Ramp XSlope LT (%)	2.4
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
Surveyor Notes:		Compliance	Description	Data	
LT RP < 5%		N/A	Ramp Length RT (in)	60.0	
		Yes	Ramp Width RT (in)	60.0	
		No	Ramp Slope RT (%)	9.5	
		Yes	Ramp XSlope RT (%)	1.3	
		N/A	DWS Provided?	N/A	
		N/A	DWS Contrast?	N/A	
		N/A	DWS Length (in)	N/A	
		N/A	DWS Full Width?	N/A	
		N/A	DWS Offset (in)	N/A	
PROW/ADA:		N/A	Gutter Slope (%)	N/A	
R304.5.3, R304.3.2		N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk2?	No	
			X Walk 2 Direction	To NW	
		N/A	X Walk 2 Width (in)	N/A	
			X Walk 2 Slope (%)	6.2	
			X Walk 2 X Slope (%)	3.8	
		N/A	Ramp inside XWalk2?	N/A	
		N/A	Clear Space?	N/A	
		N/A	Clear Space to XWalk (in)	N/A	
		N/A	Storm Grate/Utility Hazard?	N/A	
			Storm Grate/Utility Type		
Total Cost:		N/A		N/A	
		Yes	Surface Condition? (G/P)	Good	
		N/A	Curb Slope (%)	5.3	

