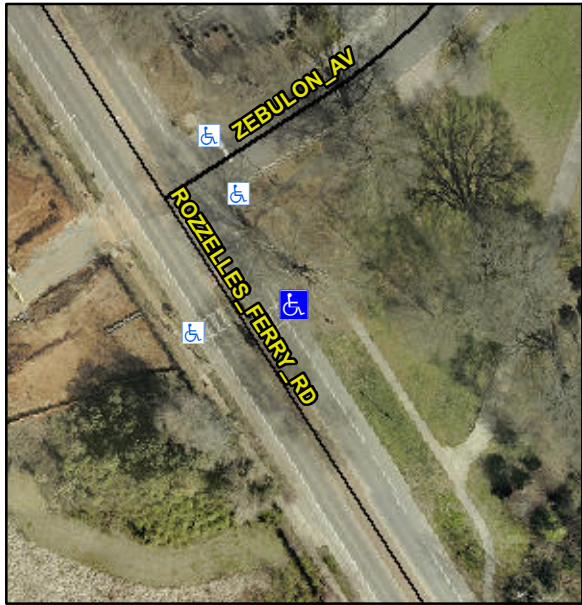


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 9767	Main Street: ROZZELLES_FERRY_RD	Cross Street: ZEBULON_AV	Location: SE
ADA ID: 766905730C11	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance																	
	Possible Solutions:		Compliance			Description			Data	Compliance			Description			Data				
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)			56.0			No	Ramp Slope (%)			15.5						
			Yes	Ramp Width (in)			58.0			Yes	Ramp XSlope (%)			2.3						
			N/A	Flare Type LT			N/A			N/A	Flare Type RT			N/A						
			N/A	Flare Slope LT (%)			N/A			N/A	Flare Slope RT (%)			N/A						
			N/A	Flare Traversable LT?			N/A			N/A	Flare Traversable RT?			N/A						
			N/A	Landing Length (in)			N/A			N/A	DWS Provided?			N/A						
			N/A	Landing Width (in)			N/A			N/A	DWS Contrast?			N/A						
			N/A	Landing Slope (%)			N/A			N/A	DWS Length (in)			N/A						
			N/A	Landing X Slope (%)			N/A			N/A	DWS Full Width?			N/A						
Surveyor Notes:		N/A	Landing Curb? (Y/N)			N/A			N/A	DWS Offset (in)			N/A							
PROW/ADA:		Not Found, R304.2.2	Shared Landing?			N/A														
			Gutter Ponding?			N/A			N/A	Gutter Slope (%)			N/A							
			Gutter Lip Ht (in)			1.0			N/A	Gutter X Slope (%)			N/A							
			Painted X Walk1?			Yes			N/A	Painted X Walk2?			N/A							
			X Walk 1 Direction			To NW			X Walk 2 Direction						N/A					
			X Walk 1 Width (in)			109.0			N/A	X Walk 2 Width (in)			N/A							
			X Walk 1 Slope (%)			3.7			X Walk 2 Slope (%)						N/A					
			X Walk 1 X Slope (%)			4.0			X Walk 2 X Slope (%)						N/A					
			Ramp inside XWalk1?			Yes			N/A	Ramp inside XWalk2?			N/A							
			Road Slope (%)			N/A			N/A	Clear Space?			N/A							
			Road X Slope (%)			N/A			N/A	Clear Space to XWalk (in)			N/A							
			Any Obstructions?			N/A			N/A	Storm Grate/Utility Hazard?			N/A							
			Obstruction Type						Storm Grate/Utility Type											
									N/A						N/A					
									Yes						Surface Condition? (G/P)			Good		
Total Cost:		\$ 1850.00																		