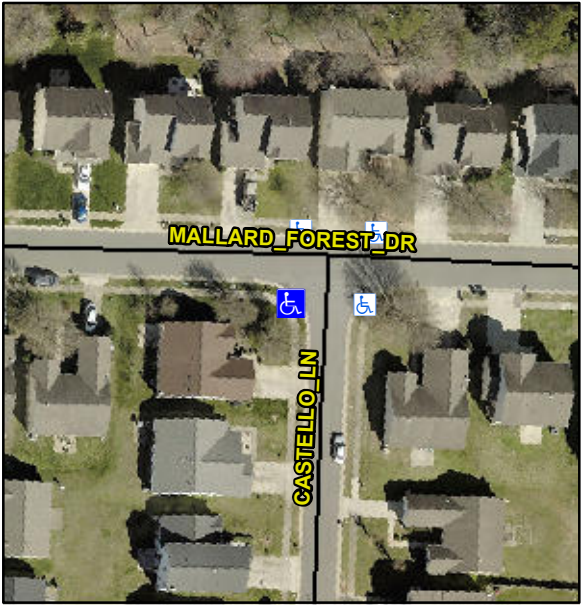


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 29247	Main Street: CASTELLO_LN	Cross Street: MALLARD_FOREST_DR	Location: SW
ADA ID: 777AAD877417	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 8.75	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Yes	Ramp Length (in)	6.4
			No	Ramp Width (in)	1.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.1</p>			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			No	Painted X Walk1?	No
				X Walk 1 Direction	To E
			N/A	X Walk 1 Width (in)	N/A
			2.8	X Walk 1 Slope (%)	2.3
			3.7	X Walk 1 X Slope (%)	2.0
			N/A	Ramp inside XWalk1?	N/A
			0.0	Road Slope (%)	N/A
			6.0	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
Total Cost:		\$ 3200.00	N/A	Storm Grate/Utility Hazard?	N/A
			N/A	Storm Grate/Utility Type	
			Yes	Surface Condition? (G/P)	Good

