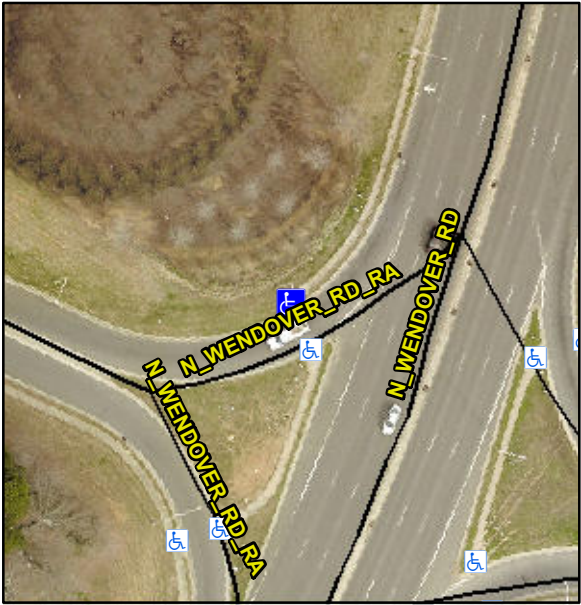


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 15397	Main Street: N_WENDOVER_RD	Cross Street: N_WENDOVER_RD_RA	Location:	N
ADA ID: 802A538706B6	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 12.5

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	81.0
	Remove & Replace Gutter.		Yes	Ramp Width (in)	49.5
			N/A	Flare Type LT	Sloped
			N/A	Flare Slope LT (%)	5.0
			N/A	Flare Traversable LT?	Yes
			No	Landing Length (in)	N/A
			No	Landing Width (in)	N/A
			No	Landing Slope (%)	N/A
			No	Landing X Slope (%)	N/A
Surveyor Notes: N/A PROW/ADA: Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305.1.4, R305.2			N/A	Flare Type RT	N/A
			Yes	Flare Slope RT (%)	7.9
			N/A	Flare Traversable RT?	Yes
			Yes	DWS Provided?	Yes
			Yes	DWS Contrast?	Yes
			Yes	DWS Length (in)	26.0
			No	DWS Full Width?	No
			No	DWS Offset (in)	2.5
			No	Shared Landing?	No
			Yes	Gutter Ponding?	No
Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1			Yes	Gutter Slope (%)	3.8
			No	Gutter X Slope (%)	2.8
			N/A	Painted X Walk1?	N/A
			To SE	X Walk 2 Direction	N/A
			N/A	X Walk 2 Width (in)	N/A
			2.0	X Walk 2 Slope (%)	N/A
			2.5	X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	N/A
			N/A	Ramp inside XWalk2?	N/A
			N/A	Clear Space?	Yes
Total Cost: \$ 2600.00			N/A	Clear Space to XWalk (in)	N/A
			Yes	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

