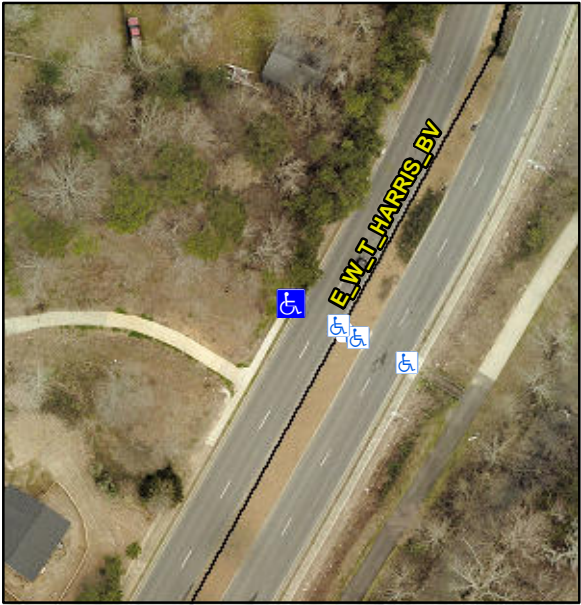



Access Compliance Report

Public Rights-of-Way (Curb Ramps)

| | | | |
|---------------------------|------------------------------|-------------------------|------------------------|
| Intersection ID: 10025574 | Main Street: E_W_T_HARRIS_BV | Cross Street: N/A | Location: NW |
| ADA ID: 83C077ED8E9A | Ramp Type: Combination1 | Initial Pass/Fail: Fail | Overall Compliance: No |
| | | | Severity Score: 8.75 |

| Codes/Mitigation Info/Possible Solution | | | Field Measurements/Component Compliance | | |
|---|-------------------------------|--|---|-----------------------------|-------------|
|  | Possible Solutions: | | Compliance | Description | Data |
| | Remove & Replace Entire Ramp. | | N/A | Ramp Length LT (in) | 75.0 |
| | Remove & Replace Sidewalk. | | No | Ramp Width LT (in) | 47.0 |
| | | | Yes | Ramp Slope LT (%) | 5.0 |
| | | | Yes | Ramp XSlope LT (%) | 1.2 |
| | | | N/A | Ramp Length (in) | 24.0 |
| | | | Yes | Ramp Width (in) | 59.0 |
| | Surveyor Notes: | | N/A | Flare Type LT | N/A |
| | N/A | | N/A | Flare Slope LT (%) | N/A |
| | | | N/A | Flare Traversable LT? | N/A |
| <p>PROW/ADA:</p> <p>Not Found, R304.5.1</p> | | | N/A | Landing Length (in) | N/A |
| | | | N/A | Landing Width (in) | N/A |
| | | | N/A | Landing Slope (%) | N/A |
| | | | N/A | Landing X Slope (%) | N/A |
| | | | N/A | Landing Curb? (Y/N) | N/A |
| | | | N/A | Shared Landing? | N/A |
| | | | N/A | Gutter Ponding? | N/A |
| | | | N/A | Gutter Lip Ht (in) | N/A |
| | | | N/A | Painted X Walk1? | No |
| | | | | X Walk 1 Direction | To SE |
| <p>Total Cost:</p> <p>\$ 2200.00</p> | | | N/A | X Walk 1 Width (in) | N/A |
| | | | | X Walk 1 Slope (%) | 2.0 |
| | | | | X Walk 1 X Slope (%) | 0.9 |
| | | | N/A | Ramp inside XWalk1? | N/A |
| | | | | Road Slope (%) | N/A |
| | | | | Road X Slope (%) | N/A |
| | | | N/A | Ramp inside XWalk2? | N/A |
| | | | | Clear Space? | N/A |
| | | | N/A | Clear Space to XWalk (in) | N/A |
| | | | N/A | Any Obstruction? | N/A |
|  | | | | Obstruction Type | N/A |
| | | | | | N/A |
| | | | N/A | Storm Grate/Utility Hazard? | N/A |
| | | | | Storm Grate/Utility Type | N/A |
| | | | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | | Curb Slope (%) | 5.3 |
| | | | | | |
| | | | | | |
| | | | | | |