


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 52127	Main Street: VALLEYDALE_RD	Cross Street: FRED_D_ALEXANDER_BV	Location: W
ADA ID: 84205FAA6785	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 13.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

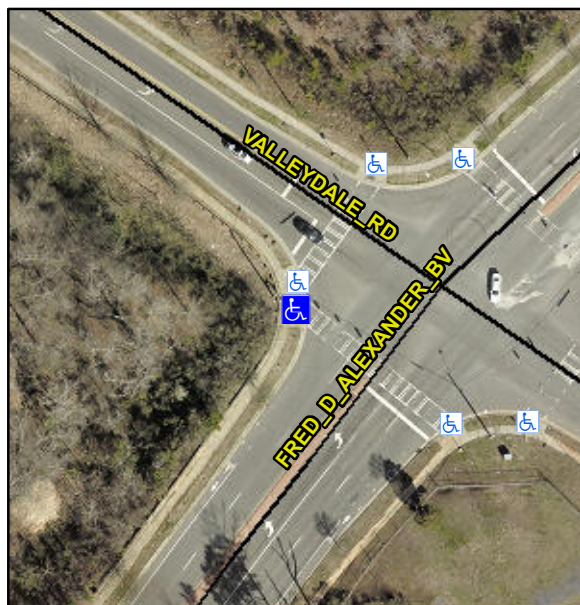

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**RP & RT RP < 5%**

PROW/ADA:

**Not Found, R304.5.3, R304.3.2**

Street 1 Name	Signal
Stop Condition-Street 1	FRED D ALEXANDER BV
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	61.0	N/A	Ramp Length RT (in)	59.0
Yes	Ramp Width LT (in)	60.0	Yes	Ramp Width RT (in)	60.0
No	Ramp Slope LT (%)	8.6	Yes	Ramp Slope RT (%)	2.1
Yes	Ramp XSlope LT (%)	0.5	Yes	Ramp XSlope RT (%)	0.4
N/A	Ramp Length (in)	68.0	Yes	Ramp Slope (%)	2.2
Yes	Ramp Width (in)	56.0	No	Ramp XSlope (%)	3.2
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	0.5	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	111.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.2		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	17.1

