


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 10033070 Main Street: NORTH_COMMUNITY_HOUSE_& Street: N/A Location: Е

Overall Compliance: No **Severity Score:** ADA ID: 884413CF14D5 Ramp Type: Perp Initial Pass/Fail: Pass 5

Codes/Mitigation Info/Possible Solution

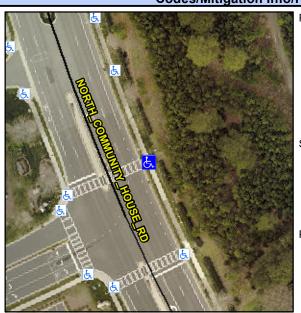

| THE RESERVE TO SERVE THE PARTY OF THE PARTY | |
|---|--------------------------|
| Street 1 Name | NORTH COMMUNITY HOUSE RD |
| Stop Condition-Street | 2 Signal |
| Street 2 Name | N/A |
| Stop Condition-Street | 1 N/A |

| 1 033IDIE OOIGHOH | |
|-------------------------------|---|
| Possible Solutions: | |
| Remove & Replace Entire Ramp. | ı |
| Remove & Replace Gutter. | • |
| | ` |
| | , |
| | I |
| | • |
| Surveyor Notes: | • |
| N/A | • |
| | • |
| | I |
| | I |
| PROW/ADA: | ` |
| Not Found, R304.5.4, R304.5.3 | ` |
| | l |
| | |
| | I |
| | |

| Total Cost: | \$ 2600.00 |
|-------------|---------------|
| | |

| Field Measurements/Component Compliance | | | | | | | | |
|---|---|-------|------|-----------------------------|------|--|--|--|
| Comp | liance Description | Data | Comp | liance Description | Data | | | |
| N/A | Ramp Length (in) | 50.0 | Yes | Ramp Slope (%) | 7.3 | | | |
| Yes | Ramp Width (in) | 60.0 | Yes | Ramp XSlope (%) | 2.0 | | | |
| Yes | Yes Flare Type LCurbed_NoWalkSurface | | Yes | Flare Type RT | N/A | | | |
| Yes | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A | | | |
| N/A | Flare Traversable LT? | No | N/A | Flare Traversable RT? | No | | | |
| Yes | Landing Length (in) | 60.0 | Yes | DWS Provided? | Yes | | | |
| Yes | Landing Width (in) | 73.0 | Yes | DWS Contrast? | Yes | | | |
| Yes | Landing Slope (%) | 1.4 | Yes | DWS Length (in) | 24.0 | | | |
| Yes | Landing X Slope (%) | 2.1 | Yes | DWS Full Width? | Yes | | | |
| N/A | Landing Curb? (Y/N) | No | Yes | DWS Offset (in) | 0.0 | | | |
| N/A | Shared Landing? | No | | | | | | |
| Yes | Gutter Ponding? | No | No | Gutter Slope (%) | 7.4 | | | |
| Yes | Gutter Lip Ht (in) | 0.0 | No | Gutter X Slope (%) | 3.5 | | | |
| N/A | Painted X Walk1? | Yes | N/A | Painted X Walk2? | N/A | | | |
| | X Walk 1 Direction | To SW | | X Walk 2 Direction | N/A | | | |
| N/A | X Walk 1 Width (in) | 112.0 | N/A | X Walk 2 Width (in) | N/A | | | |
| | X Walk 1 Slope (%) | 3.4 | | X Walk 2 Slope (%) | N/A | | | |
| | X Walk 1 X Slope (%) | 3.2 | | X Walk 2 X Slope (%) | N/A | | | |
| Yes | Ramp inside XWalk1? | Yes | N/A | Ramp inside XWalk2? | N/A | | | |
| | Road Slope (%) | N/A | N/A | Clear Space? | Yes | | | |
| | Road X Slope (%) | N/A | N/A | Clear Space to XWalk (in) | N/A | | | |
| Yes | Any Obstructions? | No | Yes | Storm Grate/Utility Hazard? | No | | | |
| | Obstruction Type | | | Storm Grate/Utility Type | | | | |
| | | N/A | | | N/A | | | |
| | | | Yes | Surface Condition? (G/P) | Good | | | |
| C. A. S. | 100000000000000000000000000000000000000 | | | | | | | |





