


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 11049	Main Street: MALTA_PL	Cross Street: OAK_FOREST_DR	Location: N
ADA ID: 89810C329683	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

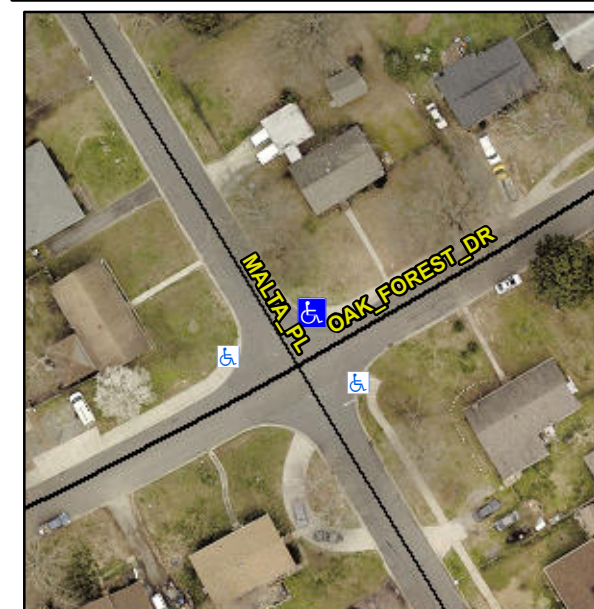

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

R304.5.3, R304.3.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	25.5	N/A	Ramp Length RT (in)	27.0
Yes	Ramp Width LT (in)	60.0	Yes	Ramp Width RT (in)	60.0
Yes	Ramp Slope LT (%)	0.8	No	Ramp Slope RT (%)	12.3
No	Ramp XSlope LT (%)	3.4	No	Ramp XSlope RT (%)	4.2
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	0.3
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	1.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.9	N/A	Clear Space?	N/A
	Road X Slope (%)	2.7	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	7.9

