


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 5758 Main Street: NEVIN_RD Cross Street: SPANISH_MOSS_LN Location: S

ADA ID: 89EE4BD02DBD Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 1.25

Codes/Mitigation Info/Possible Solution

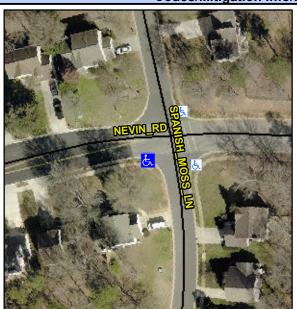

Street 1 Name
Spanish Moss LN
Stop Condition-Street 2
StopSign
Street 2 Name
N/A
Stop Condition-Street 1
N/A

Possible Solutions:	<u>c</u>
Remove & Replace Entire Ramp.	N
	Υ
	N
	N
	N
	N
Surveyor Notes:	N
N/A	N
	N
	N
	N
PROW/ADA:	N
Not Found, R304.5.3	N
	N
	N

Total Cost: \$ 1850.00

Field Measurements/Component Compliance						
Compliance Description		Data	Comp	oliance Description	Data	
N/A	Ramp Length (in)	96.0	Yes	Ramp Slope (%)	5.1	
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.9	
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A	
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
	X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	N/A	
	X Walk 1 X Slope (%)	6.4		X Walk 2 X Slope (%)	N/A	
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
	Road Slope (%)	N/A	N/A	Clear Space?	N/A	
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
	Obstruction Type			Storm Grate/Utility Type		
		N/A			N/A	
			Yes	Surface Condition? (G/P)	Good	





