

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 48945	Main Street: DAVID_JENNINGS_AV	Cross Street: CALDWELL_RIDGE_PY	Location:	N
ADA ID: 8A21C2B87215	Ramp Type: Combination2	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 10

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

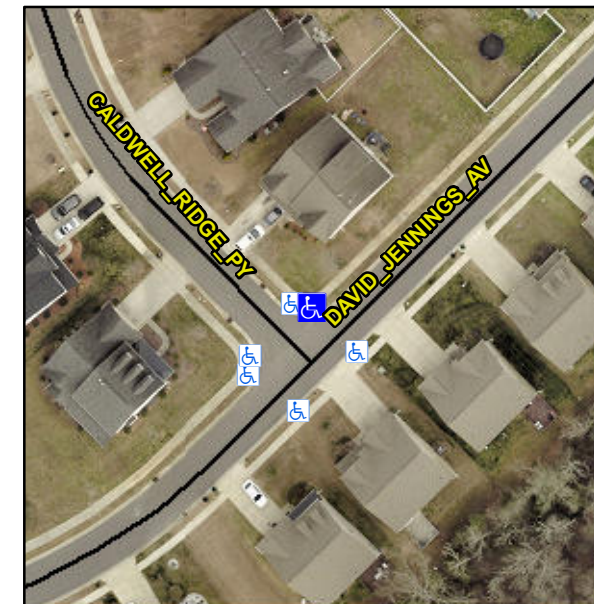

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**RT RP < 5%**

PROW/ADA:

**Not Found, R304.5.1, R304.5.3**

Street 1 Name	None
Stop Condition-Street 1	DAVID JENNINGS AV
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	13.0	N/A	Ramp Length RT (in)	16.5
Yes	Ramp Width LT (in)	59.0	N/A	Ramp Width RT (in)	59.0
Yes	Ramp Slope LT (%)	6.1	N/A	Ramp Slope RT (%)	4.9
No	Ramp XSlope LT (%)	2.3	N/A	Ramp XSlope RT (%)	2.6
N/A	Ramp Length (in)	47.0	Yes	Ramp Slope (%)	6.8
No	Ramp Width (in)	39.0	No	Ramp XSlope (%)	2.9
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
					N/A
Yes	Surface Condition? (G/P)	Good			
	Curb Slope (%)	21.8			

