


## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Intersection ID: 48470 Main Street: HALTON\_PARK\_DR **Cross Street: UNIVERSITY\_CITY\_BV** Location: NW ADA ID: 8B5B4B0BA360 Ramp Type: Perp Initial Pass/Fail: Fail **Overall Compliance: No** Severity Score: 33.75

**Codes/Mitigation Info/Possible Solution** 

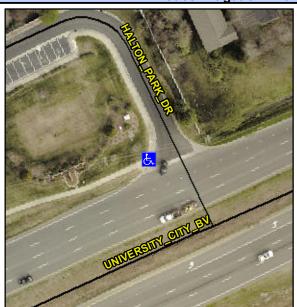

HALTON PARK DR Street 1 Name Stop Condition-Street 2 None Street 2 Name N/A Stop Condition-Street 1 N/A

Possible Solutions: Remove & Replace Entire Ramp. Surveyor Notes: N/A PROW/ADA: R304.5.1, R304.2.2

Total Cost: 1850.00

Field Measurements/Component Compliance						
Compliance Description		Data	Comp	liance Description	Data	
N	I/A	Ramp Length (in)	61.0	No	Ramp Slope (%)	16.0
N	lo	Ramp Width (in)	47.0	Yes	Ramp XSlope (%)	0.3
N	/ <b>A</b>	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N	I/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N	I/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N	I/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N	I/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N	I/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N	I/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N	l/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N	l/A	Shared Landing?	N/A			
N	l/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N	/ <b>A</b>	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N	l/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
		X Walk 1 Direction	То Е		X Walk 2 Direction	N/A
N	l/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
		X Walk 1 Slope (%)	3.8		X Walk 2 Slope (%)	N/A
		X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	N/A
N	l/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
		Road Slope (%)	N/A	N/A	Clear Space?	N/A
		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N	I/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
		Obstruction Type			Storm Grate/Utility Type	
			N/A			N/A
				Yes	Surface Condition? (G/P)	Good





