


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 9251	Main Street: MORETZ_AV	Cross Street: OLANDO_ST	Location: S
ADA ID: 8BB4BFFFC9E3	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 37.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

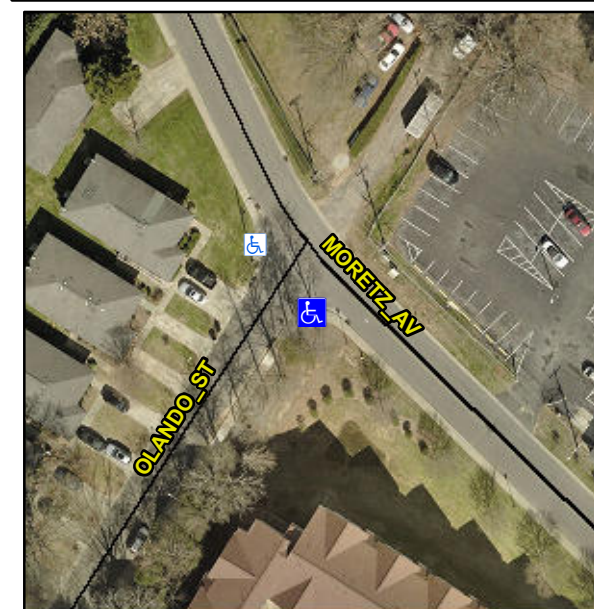

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

DWS NAILS EXPOSED, RT RP < 5%

PROW/ADA:

R304.3.2, R304.5.3

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	49.0	N/A	Ramp Length RT (in)	53.0
Yes	Ramp Width LT (in)	59.5	Yes	Ramp Width RT (in)	62.0
No	Ramp Slope LT (%)	16.0	Yes	Ramp Slope RT (%)	2.6
No	Ramp XSlope LT (%)	5.2	No	Ramp XSlope RT (%)	2.6
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.7		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	10.5

