

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 7316	Main Street: SILCHESTER_LN	Cross Street: SWINDON_CT	Location:	N
ADA ID: 8C0ED5ADC9C5	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 17.5

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

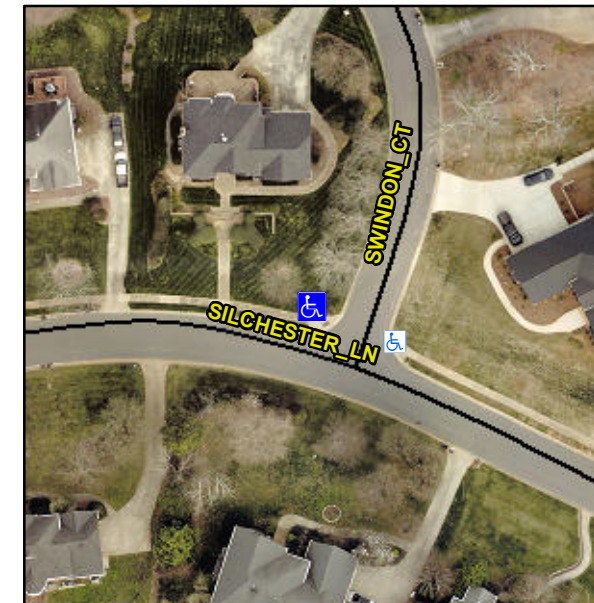

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**LT RP < 5%, RT RP < 5%**

PROW/ADA:

**R304.5.1**

Total Cost:

**\$ 1600.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	56.0	N/A	Ramp Length RT (in)	56.0
No	Ramp Width LT (in)	47.0	No	Ramp Width RT (in)	34.0
Yes	Ramp Slope LT (%)	3.4	Yes	Ramp Slope RT (%)	2.3
Yes	Ramp XSlope LT (%)	0.9	Yes	Ramp XSlope RT (%)	1.3
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	5.3		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Compliant	Curb Slope (%)	4.8

