


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 12006	Main Street: MEREDITH_AV	Cross Street: WESTERLY_HILLS_DR	Location: SE
ADA ID: 8C8D4CD34787	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 46.25			

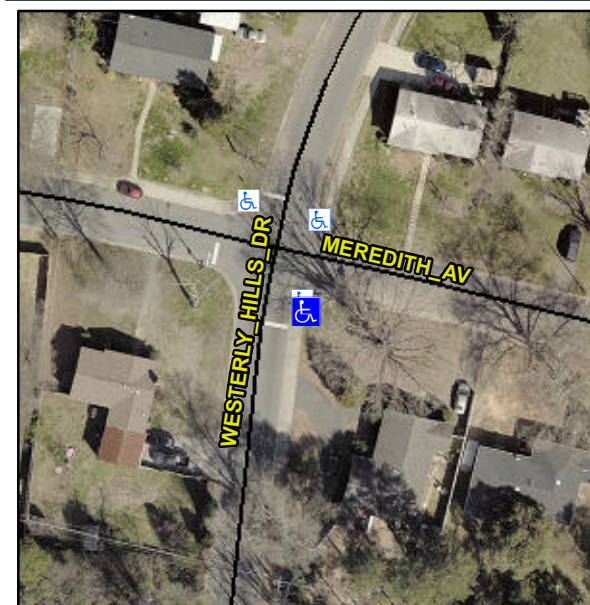

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**RP & LT RP < 5%**

PROW/ADA:

**Not Found, R304.5.1, R304.5.3, R304.3.2**

Street 1 Name	StopSign
Stop Condition-Street 1	MEREDITH_AV
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	40.0	N/A	Ramp Length RT (in)	36.5
Yes	Ramp Width LT (in)	73.0	Yes	Ramp Width RT (in)	70.0
Yes	Ramp Slope LT (%)	2.5	No	Ramp Slope RT (%)	10.3
No	Ramp XSlope LT (%)	3.4	Yes	Ramp XSlope RT (%)	0.4
N/A	Ramp Length (in)	71.0	Yes	Ramp Slope (%)	4.6
No	Ramp Width (in)	46.5	No	Ramp XSlope (%)	7.6
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.5		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
Yes	Surface Condition? (G/P)	Good			
	Curb Slope (%)	11.6			

