


## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 26090Main Street:PROVIDENCE\_RDCross Street:LAKESIDE\_DRLocation:NEADA ID: 8E33A86A4699Ramp Type:PerpendicularInitial Pass/Fail:FailOverall Compliance:NoSeverity Score:46.25

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

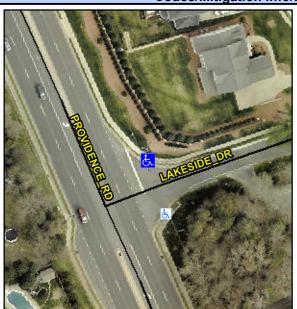

Street 1 Name

Stop Condition-Street 2

StopSign
Street 2 Name

N/A

Stop Condition-Street 1

N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.2.2, R304.5.3

Total Cost: \$ 1850.00

Field Measurements/Component Compliance					
Compliance Description		Data	Compliance Description		Data
N/A	Ramp Length (in)	75.0	No	Ramp Slope (%)	9.8
No	Ramp Width (in)	39.0	No	Ramp XSlope (%)	8.4
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
90	A WOOD SHIP OF THE SHIP	•	-		





