


Intersection ID: 10041968	Main Street: WINDSOR_CASTLE_LN	Cross Street: N/A	Location:	W
ADA ID: 8F4D87FC8BE0	Ramp Type: Perpendicular Diagonal	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 18.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
<p>1. <b>Code:</b> 101</p> <p>2. <b>Mitigation:</b> Increase the number of data points collected during the test.</p> <p>3. <b>Possible Solution:</b> Review the test setup for any leaks or misalignments.</p>	<p>1. <b>Field Measurements:</b> Pressure drop across the valve is 1.2 bar.</p> <p>2. <b>Component Compliance:</b> The valve is rated for a maximum pressure of 1.5 bar.</p>

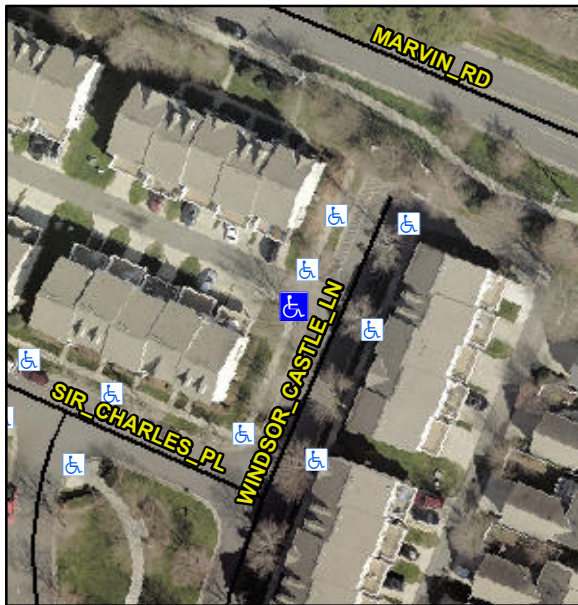

### Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

### R304.5.1

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	76.0	Yes	Ramp Slope (%)	7.2
No	Ramp Width (in)	32.0	Yes	Ramp XSlope (%)	2.5
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	1.3
	X Walk 1 X Slope (%)	3.9		X Walk 2 X Slope (%)	1.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.1	N/A	Clear Space?	N/A
	Road X Slope (%)	2.6	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3200.00

Total Cost: \$ 3200.00

