


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Interception ID: 24400	Chris at				Lesstian	14/			
Intersection ID: 31490	Main Str	Main Street: BULLOCK_DR		Cross Street: CLOVER_GAP_DR				Location:	W
ADA ID: 8F5A68552803	Ramp Ty	Ramp Type: BlendTrans1			ail: Fail Overall	o Severity Score:	8.75		
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
A		Possible Solutions:		Compliance Description Data Com			liance Description	Data	
		Remove & Replace Curb Ram	p With	N/A	Ramp Length (in)	50.5	Yes	BlendTrans Slope (%)	3.8
		Two New Directional Ramps o	•	No	Ramp Width (in)	47.0	Yes	BlendTrans XSlope (%)	0.9
		Equivalent.		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		Surveyor Notes:		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
the second secon		N/A		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
R Pis				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Reality E.				N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
ALOUL	ANT			N/A	Shared Landing?	N/A			
	11.	PROW/ADA:		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		Not Found, R304.5.1		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
					X Walk 1 Direction	To NE		X Walk 2 Direction	To SE
					X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
Street 1 Name	CLOVER GAP DR				X Walk 1 Slope (%)	3.3		X Walk 2 Slope (%)	3.4
Stop Condition-Street 1	None				X Walk 1 X Slope (%)	3.0		X Walk 2 X Slope (%)	1.6
Street 2 Name	BULLOCK DR			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
Stop Condition-Street 2	StopSign				Road Slope (%)	1.5		Clear Space?	N/A
					Road X Slope (%)	4.0	N/A	Clear Space to XWalk (in)	N/A
				N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
		Total Cost: \$	3200.00		Obstruction Type			Storm Grate/Utility Type	
						N/A			N/A



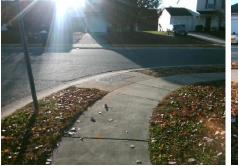



Yes

No

Surface Condition? (G/P)

Curb Slope (%)

Good

17.6