cole


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 12300	Main Street: BELLE_TERRE_AV			Street:	NASSAU_BV	Location:	NW		
ADA ID: 91B954328774	Ramp Ty	Ramp Type: BlendTrans1 Ir			ail: Fail Overall C	o Severity Score:	12.5		
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
		Possible Solutions:		Compliance Description		Data	Data Compliance Description		Data
		Remove & Replace Curb Ramp	With	N/A	Ramp Length (in)	61.0	Yes	BlendTrans Slope (%)	1.8
		Two New Directional Ramps or		Yes	Ramp Width (in)	57.0	No	BlendTrans XSlope (%)	6.1
		Equivalent.		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		2		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
BELLE TERRE AV L		Surveyor Notes:		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		1/2		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
				N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
9				N/A	Shared Landing?	N/A		2	
- Harris &		PROW/ADA:		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
A A A A A A A A A A A A A A A A A A A		Not Found, R304.5.3		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		Not Found, K304.5.5		N/A	Painted X Walk1?	No		Painted X Walk2?	N/A
	Real In			10/4	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
					X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
Street 1 Name	BELLE TERRE AV	3				6.4		()	N/A
					X Walk 1 Slope (%)	6.4 2.5		X Walk 2 Slope (%)	N/A N/A
Stop Condition-Street 1 Street 2 Name	StopSign N/A				X Walk 1 X Slope (%)		N/A	X Walk 2 X Slope (%)	N/A N/A
				N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	
Stop Condition-Street 2	N/A				Road Slope (%)	2.5		Clear Space?	N/A
					Road X Slope (%)	6.4	N/A	Clear Space to XWalk (in)	N/A
				N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
		Total Cost: \$ 3	3200.00		Obstruction Type			Storm Grate/Utility Type	
						N/A			N/A





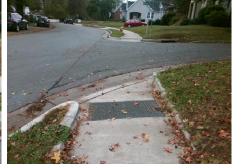

Yes

No

Surface Condition? (G/P)

Curb Slope (%)

Good

18.1