

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

10.6

1.9

N/A

No

To SE

N/A

0.2

2.0

N/A

N/A

N/A

N/A

N/A

Good

Intersection ID: 43138 Main Street: ASBURY AV **Cross Street: ATANDO AV** Location: NW Initial Pass/Fail: Fail **Overall Compliance: No** ADA ID: 93D650777E40 Ramp Type: PerpDiag Severity Score: 21.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

No

Yes

N/A

Yes

Compliance Description

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space to XWalk (in)

Storm Grate/Utility Type

Surface Condition? (G/P)

Storm Grate/Utility Hazard?

Clear Space?

Flare Traversable RT?

Data

61.0

45.0

N/A

Yes

To S

113.0

3.0

0.6


Yes

2.0

1.0

N/A

N/A

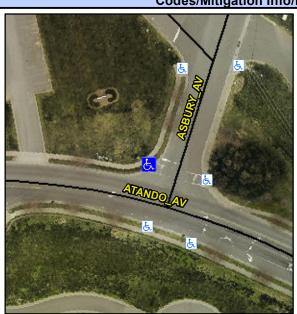

ATANDO AV Street 1 Name Stop Condition-Street 2 None **ASBURY AV** Street 2 Name Stop Condition-Street 1 StopSign Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Surveyor Notes: N/A PROW/ADA: R304.5.1, R304.2.2

Total Cost: 3200.00

N/A Flare Type LT N/A Flare Slope LT (%) N/A Flare Traversable LT? N/A Landing Length (in) N/A Landing Width (in) N/A Landing Slope (%) N/A Landing X Slope (%) N/A Landing Curb? (Y/N) N/A Shared Landing? N/A **Gutter Ponding?** N/A Gutter Lip Ht (in) N/A Painted X Walk1? X Walk 1 Direction N/A X Walk 1 Width (in) X Walk 1 Slope (%) X Walk 1 X Slope (%) N/A Ramp inside XWalk1? Road Slope (%) Road X Slope (%) N/A

N/A

No

Any Obstructions? **Obstruction Type**

Compliance Description

Ramp Length (in)

Ramp Width (in)





