

## Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 14959 Main Street: EASTLAND\_MALL\_DR Cross Street: N/A Location: W

ADA ID: 95B8C44FCC24 Ramp Type: Combination1 Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 22.5

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

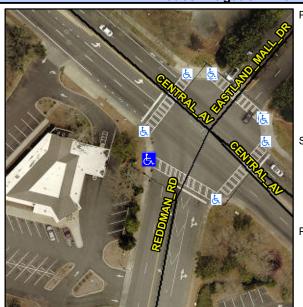

Street 1 Name
Signal
Stop Condition-Street 1
REDDMAN RD
Street 2 Name
N/A
Stop Condition-Street 2
N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

Not Found, R304.5.1, R304.5.3, R304.3.2

Total Cost: \$

Compliance Description Data		Data		liance Description	Data
N/A	Ramp Length LT (in)	65.0	N/A	Ramp Length RT (in)	65.5
Yes	Ramp Width LT (in)	72.0	Yes	Ramp Width RT (in)	72.0
Yes	Ramp Slope LT (%)	3.1	No	Ramp Slope RT (%)	10.1
Yes	Ramp XSlope LT (%)	0.8	No	Ramp XSlope RT (%)	2.8
N/A	Ramp Length (in)	72.0	Yes	Ramp Slope (%)	6.3
No	Ramp Width (in)	47.0	No	Ramp XSlope (%)	2.2
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	115.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.9		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.7		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
1			N/A	Any Obstruction?	N/A

N/A

Yes

**Obstruction Type** 

Curb Slope (%)

Storm Grate/Utility Hazard?

Storm Grate/Utility Type

Surface Condition? (G/P)

N/A

N/A

N/A

Good

21.2







1800.00