


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A		Main Street: DIXIE_RIVER_RD		Cross Street: GLENBURN_LN		Location: NW					
ADA ID: 9EC9B024E00B		Ramp Type: Directional1		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 17.5			
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance							
				Possible Solutions:		Compliance		Description		Data	
				Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	70.0	Yes	Grade Break?	Yes
				Remove & Replace Gutter.		Yes	Ramp Width (in)	67.0	No	Grade Break Slope (%)	6.3
						Yes	Ramp Slope (%)	4.0	Yes	Grade Break XSlope (%)	1.0
						Yes	Ramp XSlope (%)	0.6			
						Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
						N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
						N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
						Yes	Landing Length (in)	76.0	Yes	DWS Provided?	Yes
						Yes	Landing Width (in)	69.0	Yes	DWS Contrast?	Yes
Surveyor Notes: N/A				No	Landing Slope (%)	3.5	Yes	DWS Length (in)	24.0		
				Yes	Landing X Slope (%)	0.9	No	DWS Full Width?	No		
				N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	31.0		
				N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	2.0		
				Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.3		
				No	Gutter Lip Ht (in)	2.0	No	Gutter X Slope (%)	3.1		
				N/A	Painted X Walk1?	No		Road Slope (%)	0.7		
					X Walk 1 Direction	To SE		Road X Slope (%)	0.4		
					X Walk 1 Width (in)	N/A		Clear Space?	Yes		
					X Walk 1 Slope (%)	0.7	N/A	Clear Space to XWalk (in)	N/A		
PROW/ADA: Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305.1.4, R302.7.2				Yes	X Walk 1 X Slope (%)	0.4	Yes	Storm Grate/Utility Hazard?	No		
				N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type			
				Yes	Any Obstructions?	No			N/A		
					Obstruction Type		Yes	Surface Condition? (G/P)	Good		
							N/A	Curb Slope (%)	11.6		
Total Cost:		\$	2350.00								

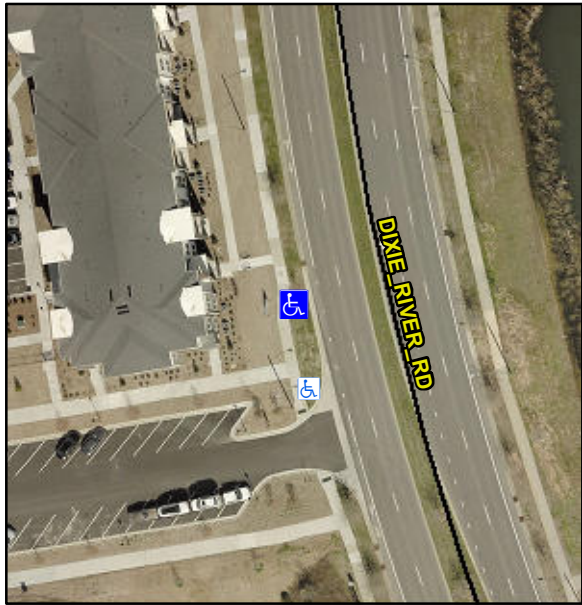