

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 3853	Main Street: CADENCIA_CT	Cross Street: GLASTON_LN	Location: S
ADA ID: 9F545278C56E	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 30	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

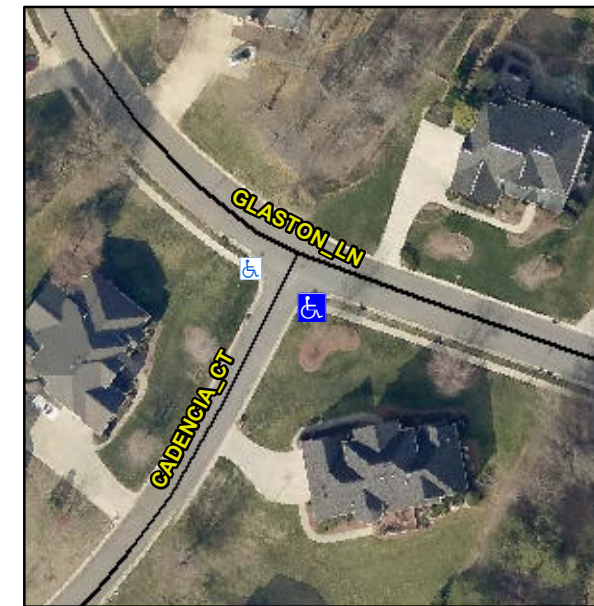

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.3, R305, R302.7.2, R304.5.4

Total Cost: \$ 2600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	42.0	Yes	Ramp Slope (%)	5.5
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	1.4	N/A	Flare Slope RT (%)	6.8
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	53.0	No	DWS Provided?	No
Yes	Landing Width (in)	86.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.2	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	2.3	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.7
No	Gutter Lip Ht (in)	1.0	No	Gutter X Slope (%)	3.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	7.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

