

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 5588 Main Street: CARVER_BV Cross Street: ROCKWELL_BV Location: S

ADA ID: A13EACF4D314 Ramp Type: Para Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 21.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

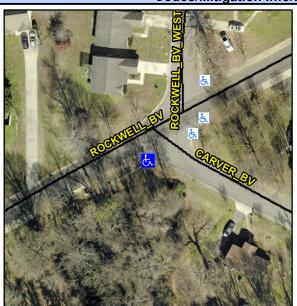

Street 1 Name
CARVER BV
Stop Condition-Street 1
None
Street 2 Name
N/A
Stop Condition-Street 2
N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.1, R304.3.2

Total Cost: \$ 1600.00

Field Measurements/Component Compliance					
Compliance Description		Data	Compliance Description		Data
N/A	Ramp Length LT (in)	67.0	N/A	Ramp Length RT (in)	60.5
No	Ramp Width LT (in)	36.0	No	Ramp Width RT (in)	36.0
No	Ramp Slope LT (%)	9.6	Yes	Ramp Slope RT (%)	5.5
Yes	Ramp XSlope LT (%)	0.6	Yes	Ramp XSlope RT (%)	0.4
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	1.0	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.1		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	8.6





