cole


Access Compliance Report Public Rights-of-Way (Curb Ramps)



		-							
Intersection ID: 9720	Main Street: N_GARDNER_AV			Cross Street: SELDON_DR				Location:	W
ADA ID: A2B3E5B92D19	Ramp Type:	Ramp Type: BlendTrans1			ail: Fail Overall (o Severity Score:	10		
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	Pos	Possible Solutions:		Compliance Description D			ata Compliance Description		Data
	R	emove & Replace Curb I	Ramp With	N/A	Ramp Length (in)	48.0	Yes	BlendTrans Slope (%)	3.2
	and the second se	wo New Directional Ram	•	No	Ramp Width (in)	47.5	Yes	BlendTrans XSlope (%)	3.0
		Equivalent.		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
	A GA			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	The second	Surveyor Notes:		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
	Sur			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
	N	/A		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
	141	2		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
				N/A	Shared Landing?	N/A			
A A A A A A A A A A A A A A A A A A A	PRO PRO	OW/ADA:		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
A BOAR	TOTAL CONTRACTOR	ot Found, R304.5.1		N/A	Gutter Lip Ht (in)	0.5	N/A	Gutter X Slope (%)	N/A
CL COL		ot i ounu, 1004.0.1		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To E		X Walk 2 Direction	N/A	
					X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
Street 1 Name	SELDON DR				X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	N/A
Stop Condition-Street 1	None				X Walk 1 X Slope (%)	4.0		X Walk 2 X Slope (%)	N/A
Street 2 Name	N/A			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
Stop Condition-Street 2	N/A				Road Slope (%)	4.0		Clear Space?	N/A
					Road X Slope (%)	3.5	N/A	Clear Space to XWalk (in)	N/A
				N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Tota	al Cost:	\$ 3200.0		Obstruction Type			Storm Grate/Utility Type	
		-	,	-		N/A			N/A
							1		





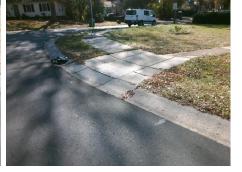

Yes

No

Surface Condition? (G/P)

Curb Slope (%)

Good

15.1