


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 5967Main Street:N_TRYON_STCross Street:MCCULLOUGH_DRLocation:NWADA ID: A53599D27973Ramp Type:PerpInitial Pass/Fail:FailOverall Compliance:NoSeverity Score:8.75

Codes/Mitigation Info/Possible Solution

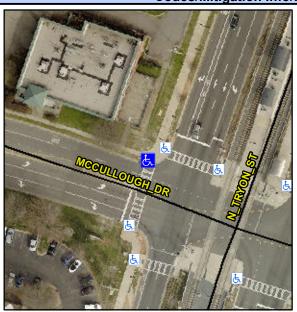

| The second secon | The state of the s |
|--|--|
| Street 1 Name | MCCULLOUGH DR |
| Stop Condition-Street 2 | Signal |
| Street 2 Name | N/A |
| Stop Condition-Street 1 | N/A |

| Possible Solutions: | Cor |
|-------------------------------|-----|
| Remove & Replace Entire Ramp. | N/A |
| | No |
| | N/A |
| | N/A |
| | N/A |
| | N/A |
| Surveyor Notes: | N/A |
| N/A | N/A |
| | N/A |
| | N/A |
| | N/A |
| PROW/ADA: | N/A |
| Not Found, R304.5.1 | N/A |
| | N/A |
| | N/A |
| | N/A |

| 100 | #. | | 1 | | |
|-----|----|----------|----------------|---|--|
| | | | To the same of | | |
| / | | A | -412 | | |
| 2 | | | | | |
| | | | | 1 | |
| | | | | | |



Total Cost:



1850.00

| Field Measurements/Component Compliance | | | | | | |
|---|-----------------------|-------|------|--------|-------------------------|------|
| Compl | iance Description | Data | Comp | liance | Description | Data |
| N/A | Ramp Length (in) | 104.0 | Yes | Ramp | Slope (%) | 5.7 |
| No | Ramp Width (in) | 46.5 | Yes | Ramp | XSlope (%) | 0.4 |
| N/A | Flare Type LT | N/A | N/A | Flare | Type RT | N/A |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare | Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | N/A | N/A | Flare | Traversable RT? | N/A |
| N/A | Landing Length (in) | N/A | N/A | DWS | Provided? | N/A |
| N/A | Landing Width (in) | N/A | N/A | DWS | Contrast? | N/A |
| N/A | Landing Slope (%) | N/A | N/A | DWS | Length (in) | N/A |
| N/A | Landing X Slope (%) | N/A | N/A | DWS | Full Width? | N/A |
| N/A | Landing Curb? (Y/N) | N/A | N/A | DWS | Offset (in) | N/A |
| N/A | Shared Landing? | N/A | | | | |
| N/A | Gutter Ponding? | N/A | N/A | Gutte | r Slope (%) | N/A |
| N/A | Gutter Lip Ht (in) | 2.0 | N/A | Gutte | r X Slope (%) | N/A |
| N/A | Painted X Walk1? | Yes | N/A | Paint | ed X Walk2? | N/A |
| | X Walk 1 Direction | To SW | | X Wa | lk 2 Direction | N/A |
| N/A | X Walk 1 Width (in) | 119.0 | N/A | X Wa | lk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 2.7 | | X Wa | lk 2 Slope (%) | N/A |
| | X Walk 1 X Slope (%) | 1.4 | | X Wa | lk 2 X Slope (%) | N/A |
| N/A | Ramp inside XWalk1? | Yes | N/A | Ramp | inside XWalk2? | N/A |
| | Road Slope (%) | N/A | N/A | Clear | Space? | N/A |
| | Road X Slope (%) | N/A | N/A | Clear | Space to XWalk (in) | N/A |
| N/A | Any Obstructions? | N/A | N/A | Storm | n Grate/Utility Hazard? | N/A |
| | Obstruction Type | | | Storm | n Grate/Utility Type | |
| | | N/A | | | | N/A |
| | | | Yes | Surfa | ce Condition? (G/P) | Good |