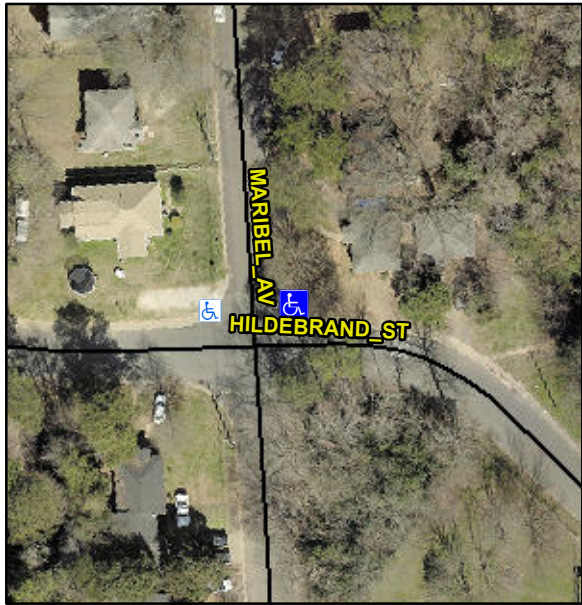


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8521	Main Street: HILDEBRAND_ST	Cross Street: MARIBEL_AV	Location: NE
ADA ID: A90C83A27C3D	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 33.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance									
	Possible Solutions:		Compliance			Description			Data			
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)		48.0		Yes	Ramp Slope (%)		7.0	
			No	Ramp Width (in)		40.0		No	Ramp XSlope (%)		10.0	
			N/A	Flare Type LT		N/A		N/A	Flare Type RT		N/A	
			N/A	Flare Slope LT (%)		N/A		N/A	Flare Slope RT (%)		N/A	
			N/A	Flare Traversable LT?		N/A		N/A	Flare Traversable RT?		N/A	
			N/A	Landing Length (in)		N/A		N/A	DWS Provided?		N/A	
			N/A	Landing Width (in)		N/A		N/A	DWS Contrast?		N/A	
			N/A	Landing Slope (%)		N/A		N/A	DWS Length (in)		N/A	
			N/A	Landing X Slope (%)		N/A		N/A	DWS Full Width?		N/A	
Surveyor Notes:	N/A		N/A	Landing Curb? (Y/N)		N/A		N/A	DWS Offset (in)		N/A	
			N/A	Shared Landing?		N/A						
			N/A	Gutter Ponding?		N/A		N/A	Gutter Slope (%)		N/A	
			N/A	Gutter Lip Ht (in)		N/A		N/A	Gutter X Slope (%)		N/A	
			N/A	Painted X Walk1?		No		N/A	Painted X Walk2?		N/A	
				X Walk 1 Direction		To W			X Walk 2 Direction		N/A	
			N/A	X Walk 1 Width (in)		N/A		N/A	X Walk 2 Width (in)		N/A	
				X Walk 1 Slope (%)		4.4			X Walk 2 Slope (%)		N/A	
				X Walk 1 X Slope (%)		4.0			X Walk 2 X Slope (%)		N/A	
			N/A	Ramp inside XWalk1?		N/A		N/A	Ramp inside XWalk2?		N/A	
PROW/ADA:	Not Found, R304.5.1, R304.5.3			Road Slope (%)		N/A		N/A	Clear Space?		N/A	
				Road X Slope (%)		N/A		N/A	Clear Space to XWalk (in)		N/A	
			N/A	Any Obstructions?		N/A		N/A	Storm Grate/Utility Hazard?		N/A	
				Obstruction Type					Storm Grate/Utility Type			
								N/A			N/A	
								Yes	Surface Condition? (G/P)		Good	
Total Cost:			\$	1850.00								

