

## Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 50740 Main Street: LEE\_MARIE\_LN Cross Street: LYNN\_LEE\_CR Location: S

ADA ID: B2F5D70AE935 Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 46.25

## **Codes/Mitigation Info/Possible Solution**

## Field Measurements/Component Compliance

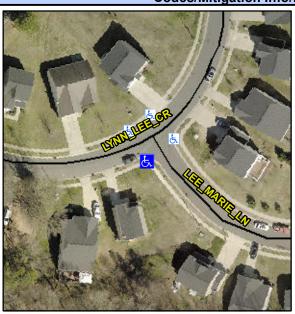

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

LEE MARIE LN None LYNN LEE CR None Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R304.5.1, R304.2.2,
R304.5.3

Total Cost: \$ 3200.00

Compliance Description Data Compliance Description Data No Ramp Slope (%) N/A Ramp Length (in) 48.0 10.2 No Ramp XSlope (%) No Ramp Width (in) 44.0 8.7 N/A N/A Flare Type LT N/A Flare Type RT N/A N/A N/A N/A Flare Slope RT (%) N/A Flare Slope LT (%) N/A Flare Traversable LT? N/A N/A Flare Traversable RT? N/A N/A N/A N/A DWS Provided? N/A Landing Length (in) N/A Landing Width (in) N/A N/A **DWS Contrast?** N/A N/A N/A N/A Landing Slope (%) DWS Length (in) N/A N/A Landing X Slope (%) N/A N/A DWS Full Width? N/A N/A Landing Curb? (Y/N) N/A N/A DWS Offset (in) N/A N/A N/A Shared Landing? N/A **Gutter Ponding?** N/A N/A Gutter Slope (%) N/A N/A Gutter Lip Ht (in) N/A N/A Gutter X Slope (%) N/A N/A Painted X Walk1? No N/A Painted X Walk2? No X Walk 1 Direction To NE X Walk 2 Direction To N N/A N/A X Walk 1 Width (in) X Walk 2 Width (in) N/A X Walk 1 Slope (%) 0.9 X Walk 2 Slope (%) 6.3 X Walk 1 X Slope (%) 8.1 X Walk 2 X Slope (%) 2.8 N/A N/A N/A Ramp inside XWalk2? N/A Ramp inside XWalk1? Road Slope (%) 7.3 N/A Clear Space? N/A N/A Road X Slope (%) 5.1 Clear Space to XWalk (in) N/A N/A N/A Any Obstructions? N/A Storm Grate/Utility Hazard? N/A **Obstruction Type** Storm Grate/Utility Type N/A N/A Yes Surface Condition? (G/P) Good





