

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 53746 Main Street: SPRINGWOOD_ESTATE_DR Cross Street: CANTERBURY_CASTLE_DR Location: SE

ADA ID: B63BD3FBE7B6 Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 33.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

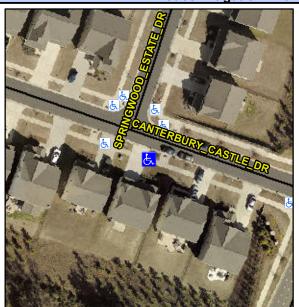

Street 1 Name CANTERBURY CASTLE DR
Stop Condition-Street 2 None
Street 2 Name N/A
Stop Condition-Street 1 N/A

PUSSIBLE SUIULIUII	
Possible Solutions:	<u>c</u>
Remove & Replace Entire Ramp.	N
	N
	N/
	N
	N
	N
Surveyor Notes:	N
N/A	N
	N
	N
	N
PROW/ADA:	N
R304.5.1, R304.2.2, R304.5.3	N/
	N
	N
	N

Total Cost:



1850.00

Comp	liance Description	Data	Comp	liance	Description	Data
N/A	Ramp Length (in)	96.0	No	Ramp	Slope (%)	9.4
No	Ramp Width (in)	47.0	No	Ramp	XSlope (%)	5.6
N/A	Flare Type LT	N/A	N/A	Flare	Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare	Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare	Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS	Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS	Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS	Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS	Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS	Offset (in)	N/A
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutte	r Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutte	r X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Paint	ed X Walk2?	N/A
	X Walk 1 Direction	To NE		X Wa	lk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Wa	lk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.8		X Wa	lk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.2		X Wa	lk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ram	inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear	Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear	Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storn	n Grate/Utility Hazard?	N/A
	Obstruction Type			Storn	n Grate/Utility Type	
		N/A				N/A
			Yes	Surfa	ce Condition? (G/P)	Good
111_	- 1 0 /					