


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 21209Main Street: GALLERIA_BVCross Street: SARDIS_RD_NORTHLocation:SEADA ID: B6FC80582E8CRamp Type: ParaInitial Pass/Fail: FailOverall Compliance: NoSeverity Score:35

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

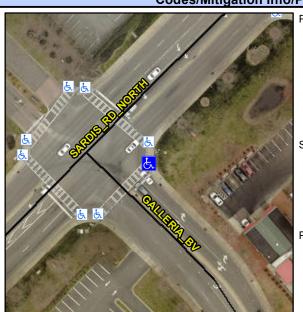

Street 1 Name

Stop Condition-Street 1

Signal
Street 2 Name

N/A

Stop Condition-Street 2

N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

R304.5.1, R304.5.3, R304.3.2

Total Cost: \$ 1600.00

Field Measurements/Component Compliance					
Compliance Description		Data	Compliance Description		Data
N/A	Ramp Length LT (in)	60.0	N/A	Ramp Length RT (in)	67.0
No	Ramp Width LT (in)	37.0	No	Ramp Width RT (in)	36.0
Yes	Ramp Slope LT (%)	2.8	No	Ramp Slope RT (%)	12.0
No	Ramp XSlope LT (%)	2.8	No	Ramp XSlope RT (%)	3.2
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	92.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.3
	AND SECRET				
THE RESERVE AND ADDRESS OF THE PARTY OF THE	The second secon				





