


## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 10714 Main Street: MULBERRY\_CHURCH\_RD Cross Street: S\_I-85\_EXIT\_33\_RA Location: N/A

ADA ID: BAF64FB68005 Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 21.25

## **Codes/Mitigation Info/Possible Solution**

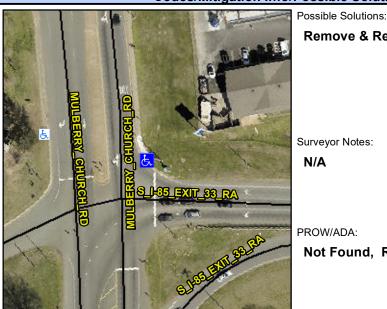

Street 1 Name

MULBERRY CHURCH RD

Stop Condition-Street 2

Signal

Street 2 Name

N/A

Stop Condition-Street 1

N/A

Possible Solutions.
Remove & Replace Entire Ramp.
Surveyor Notes:
N/A
PROW/ADA:
Not Found, R304.5.1, R304.2.2
Not 1 Julia, 11304.5.1, 11304.2.2





Total Cost:



1850.00

Field Measurements/Component Compliance						
Compliance Description Dat		Data	Compliance Description		Data	
N/A	Ramp Length (in)	60.0	No	Ramp Slope (%)	9.3	
No	Ramp Width (in)	36.0	Yes	Ramp XSlope (%)	1.3	
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A	
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
	X Walk 1 Slope (%)	1.0		X Walk 2 Slope (%)	N/A	
	X Walk 1 X Slope (%)	0.6		X Walk 2 X Slope (%)	N/A	
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
	Road Slope (%)	0.6	N/A	Clear Space?	N/A	
	Road X Slope (%)	1.0	N/A	Clear Space to XWalk (in)	N/A	
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
	Obstruction Type			Storm Grate/Utility Type		
		N/A			N/A	
			Yes	Surface Condition? (G/P)	Good	