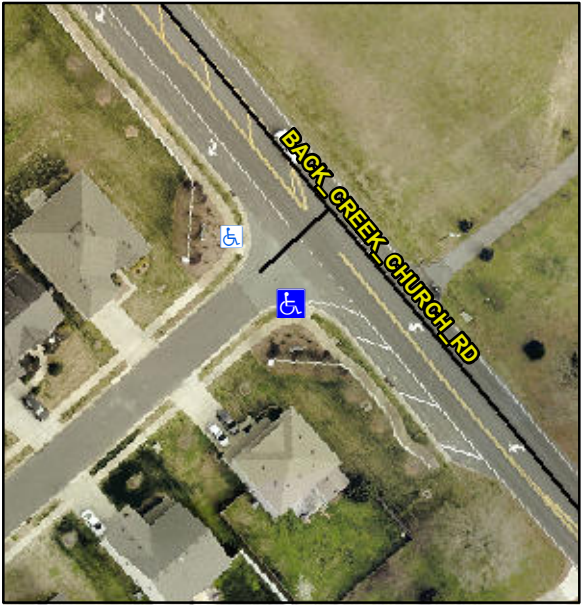


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 48259	Main Street: BELMONT_RUN_LN	Cross Street: BACK_CREEK_CHURCH_RD	Location: SW
ADA ID: BDA1BE45B093	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	Compliance
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	46.5	Yes
	Remove & Replace Gutter.		Yes	Ramp Width (in)	48.0	Yes
			N/A	Flare Type LT	Sloped	N/A
			N/A	Flare Slope LT (%)	6.8	N/A
			N/A	Flare Traversable LT?	No	N/A
			Yes	Landing Length (in)	60.0	Yes
			Yes	Landing Width (in)	48.0	Yes
			Yes	Landing Slope (%)	0.8	Yes
			Yes	Landing X Slope (%)	1.8	Yes
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R305.2, R302.7.2, R304.5.4, R304.5.3</p>			N/A	Flare Type RT	N/A	N/A
			N/A	Flare Slope RT (%)	8.7	N/A
			N/A	Flare Traversable RT?	No	N/A
			Yes	DWS Provided?	Yes	Yes
			Yes	DWS Contrast?	Yes	Yes
			Yes	DWS Length (in)	24.5	Yes
			Yes	DWS Full Width?	Yes	Yes
			N/A	DWS Offset (in)	2.5	N/A
			N/A	Gutter Slope (%)	5.7	N/A
			No	Gutter X Slope (%)	2.1	N/A
<p>Total Cost: \$ 2600.00</p>			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To NW	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	1.0	N/A
				X Walk 1 X Slope (%)	2.4	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A
			N/A	Ramp inside XWalk2?	N/A	N/A
			N/A	Clear Space?	Yes	N/A
			N/A	Clear Space to XWalk (in)	N/A	N/A
			Yes	Storm Grate/Utility Hazard?	No	Yes
<p>Obstruction Type</p>				Storm Grate/Utility Type		N/A
			N/A	Surface Condition? (G/P)	Good	Yes

