


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 52442	Main Street: WOODWARD_AV	Cross Street: BENDING_BIRCH_PL	Location: SE
ADA ID: C3C7C41C861F	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 15.25			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

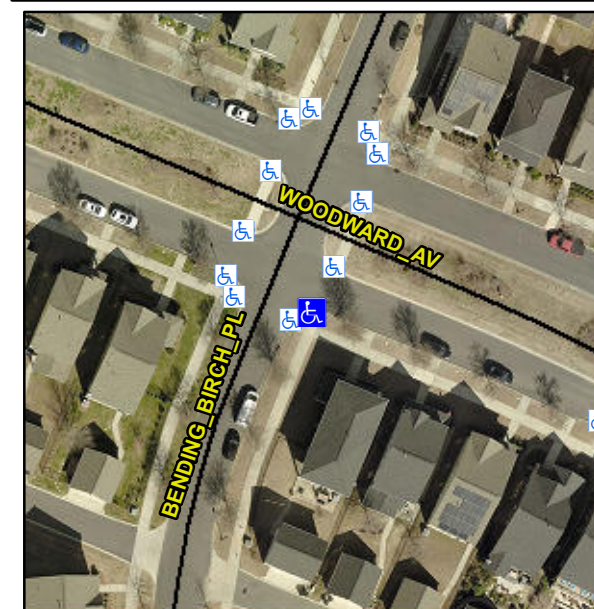

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.5.3, R304.2.2-Perp, R304.3.2-
Para, R305.2, R302.7.2**

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	81.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	63.0	Yes	Grade Break Slope (%)	4.2
Yes	Ramp Slope (%)	5.5	No	Grade Break XSlope (%)	2.1
No	Ramp XSlope (%)	4.1			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	70.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	76.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.1	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	4.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	12.0
N/A	Shared Landing?	Yes	No	DWS Offset RT (in)	3.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.9
No	Gutter Lip Ht (in)	2.0	No	Gutter X Slope (%)	2.9
N/A	Painted X Walk1?	No		Road Slope (%)	5.3
	X Walk 1 Direction	To N		Road X Slope (%)	2.0
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	5.3	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.0	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	2.7

