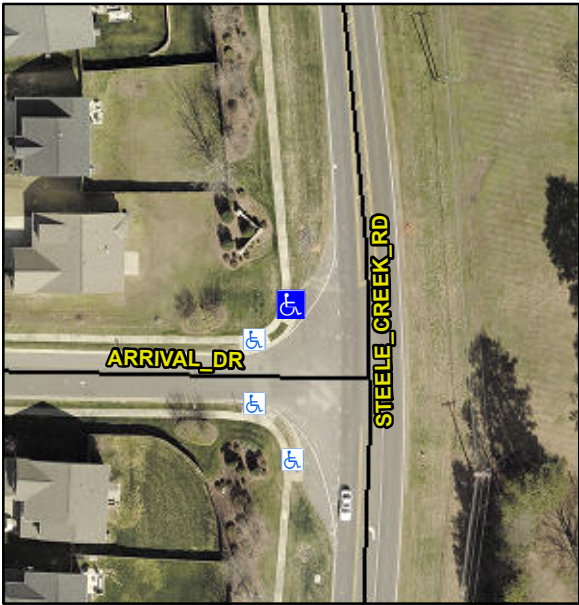



Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 50710	Main Street: STEELE_CREEK_RD	Cross Street: ARRIVAL_DR	Location: NW
ADA ID: C5DDDB3389090	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.			N/A	Ramp Length LT (in)	61.0	N/A	Ramp Length RT (in)	57.5
				No	Ramp Width LT (in)	44.0	No	Ramp Width RT (in)	42.5
				Yes	Ramp Slope LT (%)	8.2	Yes	Ramp Slope RT (%)	6.2
				No	Ramp XSlope LT (%)	3.3	Yes	Ramp XSlope RT (%)	1.6
				N/A	Ramp Length (in)	50.3	Yes	Ramp Slope (%)	8.3
				No	Ramp Width (in)	47.3	No	Ramp XSlope (%)	6.2
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
<p>Surveyor Notes:</p> <p>N/A</p>				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
				N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
				N/A	Shared Landing?	N/A			
				N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
				N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
					X Walk 1 Direction	To E		X Walk 2 Direction	N/A
<p>PROW/ADA:</p> <p>Not Found, R304.5.1, R304.5.1, R304.5.3</p>					X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
					X Walk 1 Slope (%)	5.2		X Walk 2 Slope (%)	N/A
					X Walk 1 X Slope (%)	6.2		X Walk 2 X Slope (%)	N/A
				N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
					Road Slope (%)	N/A		Clear Space?	N/A
					Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
							N/A	Any Obstruction?	N/A
								Obstruction Type	N/A
							N/A	Storm Grate/Utility Hazard?	N/A
					Storm Grate/Utility Type			N/A	
				Yes	Surface Condition? (G/P)	Good			Good
					Curb Slope (%)	7.7			7.7