


Access Compliance Report Public Rights-of-Way (Curb Ramps)

| | | | |
|------------------------|-------------------------------|--------------------------------|-------------------------------|
| Intersection ID: 53380 | Main Street: IKEA_BV | Cross Street: LEWIS_ST | Location: N |
| ADA ID: CEFDC40789DF | Ramp Type: BlendTrans1 | Initial Pass/Fail: Pass | Overall Compliance: No |
| | | | Severity Score: 7.5 |

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

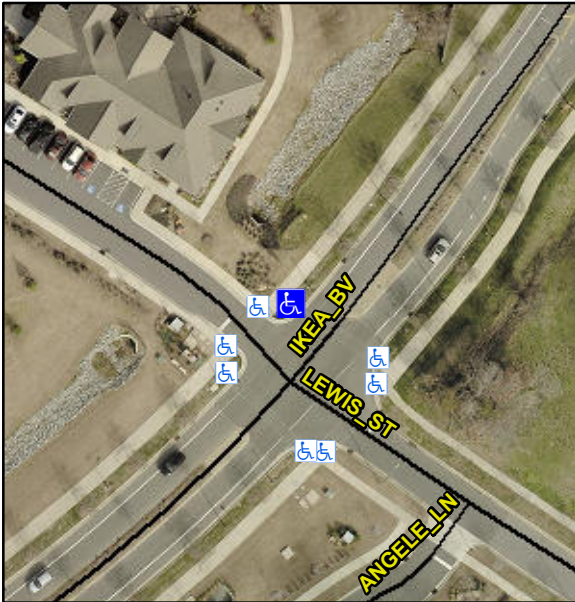

Possible Solutions:
Remove & Replace Curb Slope and Extend Ramp. Remove & Replace Gutter.

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R302.7, R302.7.2, R304.5.3

| Compliance | Description | Data | Compliance | Description | Data |
|------------|---|-------|------------|---|------|
| N/A | Ramp Length (in) | 96.0 | Yes | BlendTrans Slope (%) | 2.9 |
| Yes | Ramp Width (in) | 60.0 | Yes | BlendTrans XSlope (%) | 1.8 |
| Yes | Flare Type LCurbed_NoWalkSurface | | Yes | Flare Type RCurbed_NoWalkSurface | |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | No | N/A | Flare Traversable RT? | No |
| Yes | Landing Length (in) | 96.0 | Yes | DWS Provided? | Yes |
| Yes | Landing Width (in) | 63.0 | Yes | DWS Contrast? | Yes |
| Yes | Landing Slope (%) | 1.9 | Yes | DWS Length (in) | 24.0 |
| Yes | Landing X Slope (%) | 2.2 | Yes | DWS Full Width? | Yes |
| N/A | Landing Curb? (Y/N) | No | Yes | DWS Offset (in) | 1.0 |
| N/A | Shared Landing? | No | | | |
| No | Gutter Ponding? | Yes | Yes | Gutter Slope (%) | 4.4 |
| No | Gutter Lip Ht (in) | 0.3 | No | Gutter X Slope (%) | 3.8 |
| N/A | Painted X Walk1? | Yes | N/A | Painted X Walk2? | N/A |
| | X Walk 1 Direction | To SE | | X Walk 2 Direction | N/A |
| | X Walk 1 Width (in) | 58.0 | | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 1.8 | | X Walk 2 Slope (%) | N/A |
| | X Walk 1 X Slope (%) | 3.3 | | X Walk 2 X Slope (%) | N/A |
| Yes | Ramp inside XWalk1? | Yes | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 3.3 | | Clear Space? | Yes |
| | Road X Slope (%) | 1.8 | N/A | Clear Space to XWalk (in) | N/A |
| Yes | Any Obstructions? | No | Yes | Storm Grate/Utility Hazard? | No |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | | N/A | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | No | Curb Slope (%) | 14.5 |

Total Cost: \$ **2750.00**

| | |
|-------------------------|----------------|
| Street 1 Name | IKEA BV |
| Stop Condition-Street 1 | None |
| Street 2 Name | N/A |
| Stop Condition-Street 2 | N/A |

