


Intersection ID: 50587	Main Street: DOWNY_BIRCH_RD	Cross Street: GREAT_LAUREL_RD	Location:	SW
ADA ID: D38CD7C1228B	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 13.75

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
<p>1. Code 100: No issues detected.</p> <p>2. Code 200: Minor issues detected. Possible solutions include:</p> <ul style="list-style-type: none"> Check for loose connections. Verify component specifications. 	<p>1. Field Measurements: All components are within tolerance.</p> <p>2. Component Compliance: All components meet or exceed specifications.</p>

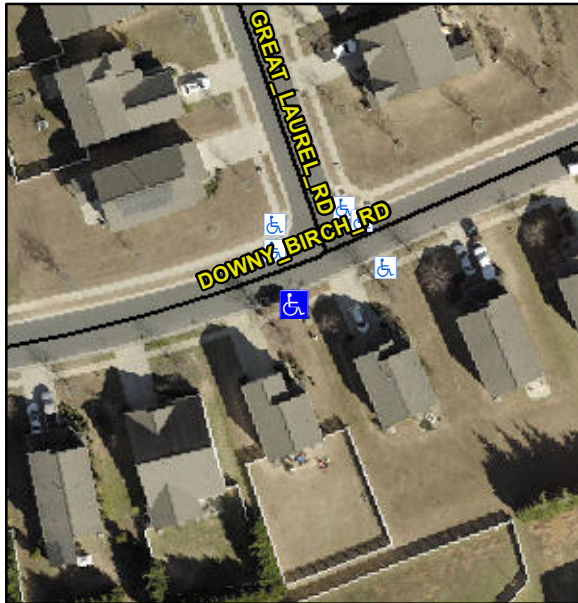

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2, R304.5.3

Possible Solutions:			Compliance	Description	Data	Compliance	Description	Data
Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	47.0	No	Ramp Slope (%)	8.6		
	Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.1		
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
Surveyor Notes: N/A	N/A	Shared Landing?	N/A					
	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A		
		X Walk 1 Direction	To N		X Walk 2 Direction	N/A		
	N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
		X Walk 1 Slope (%)	1.2		X Walk 2 Slope (%)	N/A		
		X Walk 1 X Slope (%)	1.9		X Walk 2 X Slope (%)	N/A		
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
		Road Slope (%)	N/A	N/A	Clear Space?	N/A		
PROW/ADA: Not Found, R304.2.2, R304.5.3		Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A		
	N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
		Obstruction Type			Storm Grate/Utility Type			
			N/A			N/A		
				Yes	Surface Condition? (G/P)	Good		
	Total Cost:	\$	1850.00					

Total Cost: \$ 1850.00

