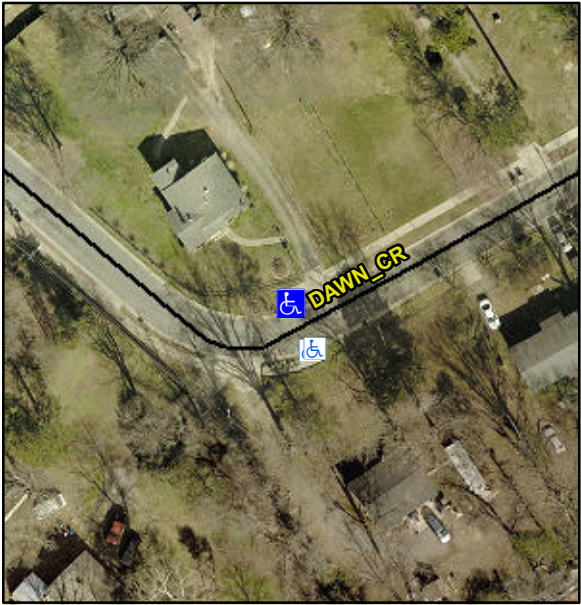


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10011755	Main Street: DAWN_CR	Cross Street: N/A	Location: E
ADA ID: D8190E7C6B13	Ramp Type: Combination2	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance			
	Possible Solutions:			Compliance	Description	Data	Compliance
	Remove & Replace Entire Ramp.			N/A	Ramp Length LT (in)	27.0	N/A
				N/A	Ramp Width LT (in)	60.0	Yes
				N/A	Ramp Slope LT (%)	4.4	Yes
				N/A	Ramp XSlope LT (%)	0.9	No
				N/A	Ramp Length (in)	72.0	Yes
				Yes	Ramp Width (in)	48.0	No
				N/A	Flare Type LT	N/A	N/A
				N/A	Flare Slope LT (%)	N/A	N/A
				N/A	Flare Traversable LT?	N/A	N/A
				N/A	Landing Length (in)	N/A	N/A
				N/A	Landing Width (in)	N/A	N/A
				N/A	Landing Slope (%)	N/A	N/A
				N/A	Landing X Slope (%)	N/A	N/A
				N/A	Landing Curb? (Y/N)	N/A	N/A
				N/A	Shared Landing?	N/A	N/A
				N/A	Gutter Ponding?	N/A	N/A
				N/A	Gutter Lip Ht (in)	N/A	N/A
				N/A	Painted X Walk1?	No	N/A
					X Walk 1 Direction	To SE	
					X Walk 1 Width (in)	N/A	
					X Walk 1 Slope (%)	4.5	
					X Walk 1 X Slope (%)	3.6	
					X Walk 2 Direction		
					X Walk 2 Width (in)		
					X Walk 2 Slope (%)		
					X Walk 2 X Slope (%)		
					Ramp inside XWalk1?	N/A	N/A
					Ramp inside XWalk2?	N/A	N/A
					Road Slope (%)	N/A	N/A
					Road X Slope (%)	N/A	N/A
					Clear Space?		
					Clear Space to XWalk (in)		
					Any Obstruction?		
					Obstruction Type		
							N/A
					Storm Grate/Utility Hazard?		
					Storm Grate/Utility Type		
							N/A
				Yes	Surface Condition? (G/P)		Good
					Curb Slope (%)		15.1

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

DAMAGED DWS, LT RP < 5%

PROW/ADA:

Not Found, R304.5.3

Total Cost:

\$ 1600.00

N/A

Ramp inside XWalk1?

N/A

Ramp inside XWalk2?

N/A

Road Slope (%)

N/A

Clear Space?

N/A

Road X Slope (%)

N/A

Clear Space to XWalk (in)

N/A

Any Obstruction?

N/A

Obstruction Type

N/A

Storm Grate/Utility Hazard?

N/A

Storm Grate/Utility Type

N/A

Surface Condition? (G/P)

Good

Curb Slope (%)

15.1

