


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 48374 Main Street: REDBUD ST **Cross Street: TATE_ST** Location: NW **Severity Score: Overall Compliance: No** ADA ID: DB687627D531 Ramp Type: Para Initial Pass/Fail: Fail 22.5

Codes/Mitigation Info/Possible Solution

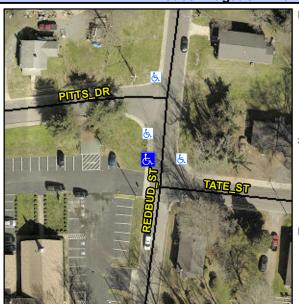

	SEMPLE II ST
Street 1 Name	REDBUD ST
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Possible Solutions:	9
Remove & Replace Entire Ramp.	ı
·	١
	1
	1
	1
	ı
Surveyor Notes:	ı
RT RP < 5%	N
	ı
	N
	N
PROW/ADA:	N
R304.5.1, R304.3.2, R304.5.3	N
	ŀ
	N

THE VISITE	Action



Total Cost:



1600.00

Field Measurements/Component Compliance							
Comp	liance Description	Data	Comp	liance Description	Data		
N/A	Ramp Length LT (in)	70.0	N/A	Ramp Length RT (in)	74.0		
Yes	Ramp Width LT (in)	48.0	No	Ramp Width RT (in)	47.0		
No	Ramp Slope LT (%)	9.4	Yes	Ramp Slope RT (%)	3.7		
No	Ramp XSlope LT (%)	2.2	No	Ramp XSlope RT (%)	2.3		
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
N/A	Shared Landing?	N/A					
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A		
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A		
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
	X Walk 1 Slope (%)	7.2		X Walk 2 Slope (%)	N/A		
	X Walk 1 X Slope (%)	2.9		X Walk 2 X Slope (%)	N/A		
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
	Road Slope (%)	N/A	N/A	Clear Space?	N/A		
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A		
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
	Obstruction Type			Storm Grate/Utility Type			
		N/A			N/A		
			Yes	Surface Condition? (G/P)	Good		
			N/A	Curb Slope (%)	13.0		