

## Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 12150 Main Street: W\_MARTIN\_LUTHER\_KING\_JRCEO/ss Street: S\_GRAHAM\_ST Location: W

ADA ID: E08F19908841 Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 33.75

## **Codes/Mitigation Info/Possible Solution**

N/A

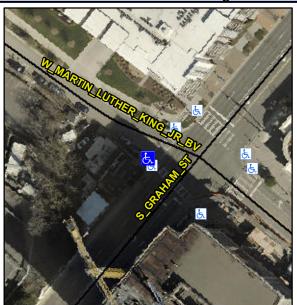

Street 1 Name W MARTIN LUTHER KING JR BV
Stop Condition-Street 2 Signal
Street 2 Name N/A

OSSIDIE OCIULION	
Possible Solutions:	Co
Remove & Replace Entire Ramp.	N/A
•	No
	N/A
	N/A
	N/A
	N/A
Surveyor Notes:	N/A
N/A	N/A
	N/A
	N/A
	N/A
PROW/ADA:	N/A
R304.5.1, R304.5.3	N/A
,	N/A
	N/A

Total Cost: \$ 1850.00

Field Measurements/Component Compliance						
Compliance Description		Data	Comp	liance Description	Data	
N/A	Ramp Length (in)	86.0	Yes	Ramp Slope (%)	7.4	
No	Ramp Width (in)	44.0	No	Ramp XSlope (%)	7.4	
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A	
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A	
N/A	X Walk 1 Width (in)	105.0	N/A	X Walk 2 Width (in)	N/A	
	X Walk 1 Slope (%)	7.6		X Walk 2 Slope (%)	N/A	
	X Walk 1 X Slope (%)	0.4		X Walk 2 X Slope (%)	N/A	
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A	
	Road Slope (%)	N/A	N/A	Clear Space?	N/A	
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
	Obstruction Type			Storm Grate/Utility Type		
		N/A			N/A	
			Yes	Surface Condition? (G/P)	Good	



Stop Condition-Street 1



