


|                       |                        |                           |                        |                      |
|-----------------------|------------------------|---------------------------|------------------------|----------------------|
| Intersection ID: 8037 | Main Street: AUSTIN_DR | Cross Street: ELGYWOOD_LN | Location:              | NW                   |
| ADA ID: E2A2BF9611C7  | Ramp Type: Para        | Initial Pass/Fail: Fail   | Overall Compliance: No | Severity Score: 12.5 |

| Codes/Mitigation Info/Possible Solution | Field Measurements/Component Compliance |
|---|---|
|---|---|

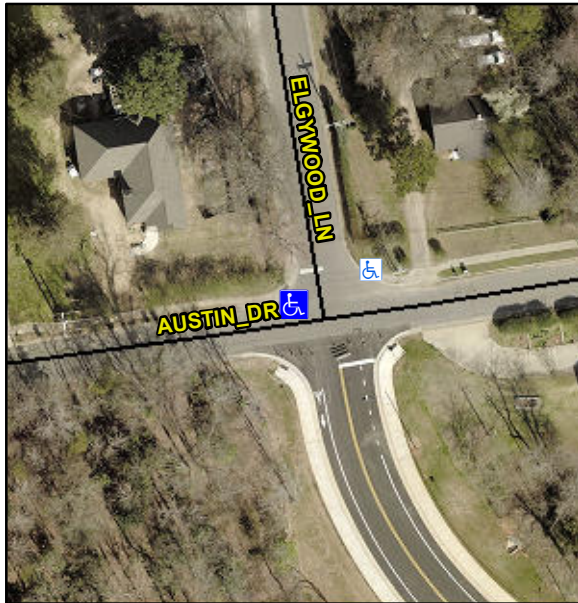

### Possible Solutions:

### Remove & Replace Entire Ramp.

Surveyor Notes:

**CURB GAP 1.0, LT RP < 5%**

PROW/ADA:

### R304.3.2

| Compliance | Description          | Data | Compliance | Description                 | Data |
|------------|----------------------|------|------------|-----------------------------|------|
| N/A        | Ramp Length LT (in)  | 20.5 | N/A        | Ramp Length RT (in)         | 24.0 |
| Yes        | Ramp Width LT (in)   | 60.0 | Yes        | Ramp Width RT (in)          | 59.5 |
| Yes        | Ramp Slope LT (%)    | 0.6  | No         | Ramp Slope RT (%)           | 9.9  |
| Yes        | Ramp XSlope LT (%)   | 1.5  | Yes        | Ramp XSlope RT (%)          | 1.0  |
| N/A        | Landing Length (in)  | N/A  | N/A        | DWS Provided?               | N/A  |
| N/A        | Landing Width (in)   | N/A  | N/A        | DWS Contrast?               | N/A  |
| N/A        | Landing Slope (%)    | N/A  | N/A        | DWS Length (in)             | N/A  |
| N/A        | Landing X Slope (%)  | N/A  | N/A        | DWS Full Width?             | N/A  |
| N/A        | Landing Curb? (Y/N)  | N/A  | N/A        | DWS Offset (in)             | N/A  |
| N/A        | Shared Landing?      | N/A  |            |                             |      |
| N/A        | Gutter Ponding?      | N/A  | N/A        | Gutter Slope (%)            | N/A  |
| N/A        | Gutter Lip Ht (in)   | N/A  | N/A        | Gutter X Slope (%)          | N/A  |
| N/A        | Painted X Walk1?     | No   | N/A        | Painted X Walk2?            | N/A  |
|            | X Walk 1 Direction   | To E |            | X Walk 2 Direction          | N/A  |
| N/A        | X Walk 1 Width (in)  | N/A  | N/A        | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)   | 2.0  |            | X Walk 2 Slope (%)          | N/A  |
|            | X Walk 1 X Slope (%) | 5.1  |            | X Walk 2 X Slope (%)        | N/A  |
| N/A        | Ramp inside XWalk1?  | N/A  | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)       | N/A  | N/A        | Clear Space?                | N/A  |
|            | Road X Slope (%)     | N/A  | N/A        | Clear Space to XWalk (in)   | N/A  |
| N/A        | Any Obstructions?    | N/A  | N/A        | Storm Grate/Utility Hazard? | N/A  |
|            | Obstruction Type     |      |            | Storm Grate/Utility Type    |      |
|            |                      | N/A  |            |                             | N/A  |
|            |                      |      | Yes        | Surface Condition? (G/P)    | Good |
|            |                      |      | N/A        | Curb Slope (%)              | 28.0 |

**Total Cost: \$ 1600.00**

