

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 2956 Main Street: COTTAGE_OAKS_DR Cross Street: JOHNSTON_MILL_CT Location: NW

ADA ID: E668F7CBEBF6 Ramp Type: BlendTrans1 Initial Pass/Fail: Pass Overall Compliance: No Severity Score: 7.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

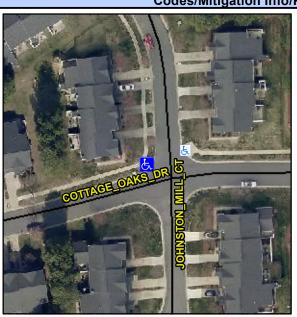

Street 1 Name
Stop Condition-Street 1
Street 2 Name
Stop Condition-Street 2

COTTAGE OAKS DR
None
JOHNSTON MILL CT
StopSign

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2, R304.5.4

Total Cost: \$ 3950.00

Compliance Description Detailed on Detailed on Description Detailed on Detaile					
Compliance Description		Data		oliance Description	<u>Data</u>
N/A	Ramp Length (in)	83.0	Yes	BlendTrans Slope (%)	0.2
Yes	Ramp Width (in)	132.0	Yes	BlendTrans XSlope (%)	2.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	3.7	N/A	Flare Slope RT (%)	1.9
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	100.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.8	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.4	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.4
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.9		X Walk 2 Slope (%)	0.4
	X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	3.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.0		Clear Space?	Yes
	Road X Slope (%)	3.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A

Yes

No

Surface Condition? (G/P)

Curb Slope (%)

Good

16.5





