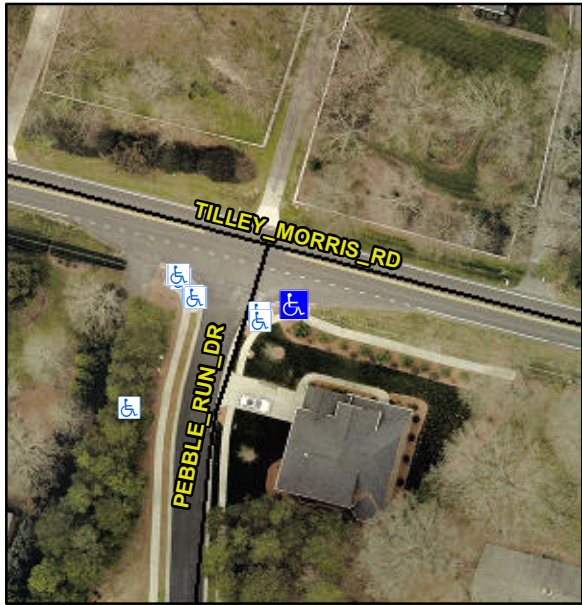



# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 49458	Main Street: PEBBLE_RUN_DR	Cross Street: TILLEY_MORRIS_RD	Location: SE
ADA ID: E8C63D5817AF	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 33.75

Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
	Possible Solutions:			<b>Compliance</b>	<b>Description</b>	<b>Data</b>	<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Entire Ramp.</b>			N/A	Ramp Length LT (in)	53.0	N/A	Ramp Length RT (in)	41.0
				Yes	Ramp Width LT (in)	50.0	No	Ramp Width RT (in)	47.0
				No	Ramp Slope LT (%)	12.4	Yes	Ramp Slope RT (%)	1.3
				Yes	Ramp XSlope LT (%)	1.9	Yes	Ramp XSlope RT (%)	1.5
				N/A	Ramp Length (in)	47.0	Yes	Ramp Slope (%)	3.6
				No	Ramp Width (in)	47.5	Yes	Ramp XSlope (%)	0.1
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
<p>Surveyor Notes:</p> <p><b>RP &amp; RT RP &lt; 5%</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.5.1, R304.5.1, R304.3.2</b></p>				N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
				N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
				N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
				N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
				N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
				N/A	Shared Landing?	N/A			
				N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
				N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
				N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
					X Walk 1 Direction	To N		X Walk 2 Direction	N/A
					X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
					X Walk 1 Slope (%)	3.4		X Walk 2 Slope (%)	N/A
					X Walk 1 X Slope (%)	2.1		X Walk 2 X Slope (%)	N/A
				N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
					Road Slope (%)	N/A		Clear Space?	N/A
					Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
							N/A	Any Obstruction?	N/A
								Obstruction Type	N/A
							N/A	Storm Grate/Utility Hazard?	N/A
								Storm Grate/Utility Type	N/A
				Yes	Surface Condition? (G/P)	Good			
					Curb Slope (%)	10.0			