


|                        |                         |                                    |                        |                       |
|------------------------|-------------------------|------------------------------------|------------------------|-----------------------|
| Intersection ID: 11357 | Main Street: W_TRADE_ST | Cross Street: JOHNSON_AND_WALES_WY | Location:              | W                     |
| ADA ID: EA2045ABD1E6   | Ramp Type: BlendTrans1  | Initial Pass/Fail: Pass            | Overall Compliance: No | Severity Score: 15.25 |

| Codes/Mitigation Info/Possible Solution | Field Measurements/Component Compliance |
|-----------------------------------------|-----------------------------------------|
|-----------------------------------------|-----------------------------------------|

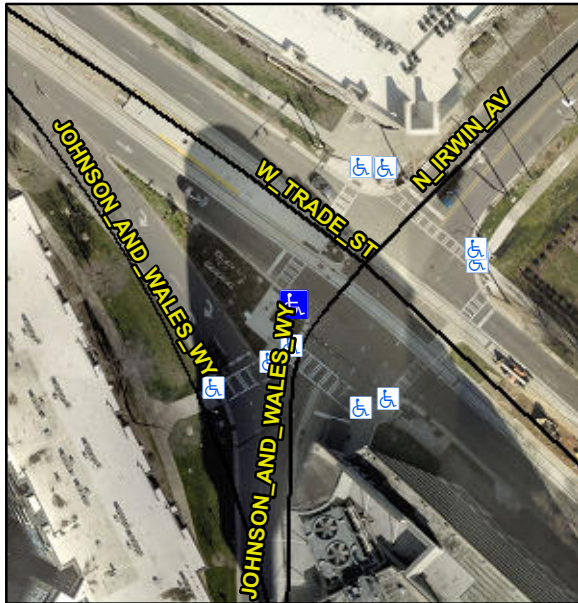

### Possible Solutions:

**Grind Gutter Lip. Utility Present.**

Surveyor Notes:

**LOCATED ON ISLAND**

PROW/ADA:

**R302.7.2, R302.3, R402.2**

Total Cost: \$ 5200.00

| Compliance      | Description           | Data  | Compliance | Description                 | Data                 |
|-----------------|-----------------------|-------|------------|-----------------------------|----------------------|
| N/A             | Ramp Length (in)      | 129.0 | Yes        | BlendTrans Slope (%)        | 1.8                  |
| Yes             | Ramp Width (in)       | 94.0  | Yes        | BlendTrans XSlope (%)       | 3.4                  |
| N/A             | Flare Type LT         | None  | Yes        | Flare Type RT               | Curbed_NoWalkSurface |
| N/A             | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A                  |
| N/A             | Flare Traversable LT? | N/A   | N/A        | Flare Traversable RT?       | No                   |
| Yes             | Landing Length (in)   | 66.0  | Yes        | DWS Provided?               | Yes                  |
| Yes             | Landing Width (in)    | 100.0 | Yes        | DWS Contrast?               | Yes                  |
| Yes             | Landing Slope (%)     | 0.2   | Yes        | DWS Length (in)             | 24.0                 |
| Yes             | Landing X Slope (%)   | 3.6   | Yes        | DWS Full Width?             | Yes                  |
| N/A             | Landing Curb? (Y/N)   | No    | Yes        | DWS Offset (in)             | 0.0                  |
| N/A             | Shared Landing?       | No    |            |                             |                      |
| Yes             | Gutter Ponding?       | No    | Yes        | Gutter Slope (%)            | 0.9                  |
| No              | Gutter Lip Ht (in)    | 1.0   | Yes        | Gutter X Slope (%)          | 3.8                  |
| N/A             | Painted X Walk1?      | Yes   | N/A        | Painted X Walk2?            | N/A                  |
|                 | X Walk 1 Direction    | To NE |            | X Walk 2 Direction          | N/A                  |
|                 | X Walk 1 Width (in)   | 79.0  |            | X Walk 2 Width (in)         | N/A                  |
|                 | X Walk 1 Slope (%)    | 2.6   |            | X Walk 2 Slope (%)          | N/A                  |
|                 | X Walk 1 X Slope (%)  | 4.9   |            | X Walk 2 X Slope (%)        | N/A                  |
| Yes             | Ramp inside XWalk1?   | Yes   | N/A        | Ramp inside XWalk2?         | N/A                  |
|                 | Road Slope (%)        | 4.9   |            | Clear Space?                | Yes                  |
|                 | Road X Slope (%)      | 2.6   | N/A        | Clear Space to XWalk (in)   | N/A                  |
| Yes             | Any Obstructions?     | Yes   | No         | Storm Grate/Utility Hazard? | No                   |
|                 | Obstruction Type      |       |            | Storm Grate/Utility Type    |                      |
| PULLBOX LIP 9.5 |                       |       |            |                             | N/A                  |
|                 |                       |       | Yes        | Surface Condition? (G/P)    | Good                 |
|                 |                       |       | Yes        | Curb Slope (%)              | 3.9                  |

