

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28305	Main Street: COMMUNITY HOUSE RD	Cross Street: TAMARACK DR	Location:	N
ADA ID: EA5E982B9D4A	Ramp Type: Combination1Diag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

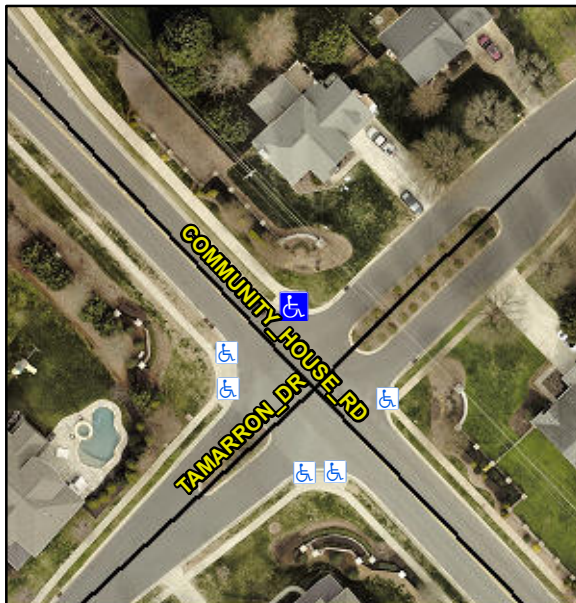

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

RP < 5 %, CURB WIDTH 44.0

PROW/ADA:

R304.5.1, R304.5.3

Street 1 Name **None**
 Stop Condition-Street 1 **COMMUNITY HOUSE RD**
 Street 2 Name **StopSign**
 Stop Condition-Street 2 **TAMARRON DR**

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	41.0	N/A	Ramp Length RT (in)	48.0
Yes	Ramp Width LT (in)	70.0	Yes	Ramp Width RT (in)	71.0
Yes	Ramp Slope LT (%)	7.0	Yes	Ramp Slope RT (%)	7.1
Yes	Ramp XSlope LT (%)	1.5	No	Ramp XSlope RT (%)	2.8
N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	4.7
No	Ramp Width (in)	47.0	Yes	Ramp XSlope (%)	0.5
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.5		X Walk 2 Slope (%)	1.4
	X Walk 1 X Slope (%)	0.2		X Walk 2 X Slope (%)	1.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.6		Clear Space?	N/A
	Road X Slope (%)	1.4	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
Yes	Surface Condition? (G/P)	Good			
	Curb Slope (%)	0.6			

